

# Home report



**[thorntons-property.co.uk](https://www.thorntons-property.co.uk)**

Thorntons is a trading name of Thorntons Law LLP

# property questionnaire

|   |  |
|---|--|
| Property address                          | BRENLYN<br>HILLHOUSE<br>STRATHMARTINE<br>DD3 0PX |
| Seller(s)                                 | MRS MARY CRAIB                                   |
| Completion date of property questionnaire | 09/03/2020                                       |

# property questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

|    |  |   |
|----|--|---|
| 1. | <b>Length of ownership</b>   |   |
|    | How long have you owned the property?  | APPROX 20 YEARS   |
| 2. | <b>Council tax</b>   |   |
|    | Which Council Tax band is your property in? (Please tick)  |   |
|    | A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input checked="" type="checkbox"/> E <input type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H <input type="checkbox"/>   |   |
| 3. | <b>Parking</b>   |   |
|    | What are the arrangements for parking at your property?<br>(Please tick all that apply) <ul style="list-style-type: none"> <li>• Garage <input checked="" type="checkbox"/></li> <li>• Allocated parking space <input type="checkbox"/></li> <li>• Driveway <input checked="" type="checkbox"/></li> <li>• Shared parking <input type="checkbox"/></li> <li>• On street <input type="checkbox"/></li> <li>• Resident permit <input type="checkbox"/></li> <li>• Metered parking <input type="checkbox"/></li> <li>• Other (please specify):</li> </ul> |   |
| 4. | <b>Conservation area</b>   |   |
|    | Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?   | Yes <input type="checkbox"/><br>No <input type="checkbox"/><br>Don't know <input checked="" type="checkbox"/> |
| 5. | <b>Listed buildings</b>  |   |
|    | Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?   | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/>  |
| 6. | <b>Alterations/additions/extensions</b>  |   |
| a. | (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/>  |

# property questionnaire

|           |   |  |
|-----------|---|--|
|           | <b>If you have answered yes, please describe below the changes which you have made:</b>   |  |
|           | <b>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</b><br><b>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</b><br><b>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</b>   | <b>Yes</b> <input type="checkbox"/><br><b>No</b> <input type="checkbox"/>  |
| <b>b.</b> | <b>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</b><br><b>If you have answered yes, please answer the three questions below:</b>  | <b>Yes</b> <input checked="" type="checkbox"/><br><b>No</b> <input type="checkbox"/>   |
|           | <b>(i) Were the replacements the same shape and type as the ones you replaced?</b>  | <b>Yes</b> <input checked="" type="checkbox"/><br><b>No</b> <input type="checkbox"/>   |
|           | <b>(ii) Did this work involve any changes to the window or door openings?</b>   | <b>Yes</b> <input type="checkbox"/><br><b>No</b> <input checked="" type="checkbox"/>   |
|           | <b>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</b><br>APPROX 2005<br><b>Please give any guarantees which you received for this work to your solicitor or estate agent.</b>  |  |
| <b>7.</b> | <b>Central heating</b>  |  |
| <b>a.</b> | <b>Is there a central heating system in your property?</b><br><b>(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</b><br><br><b>If you have answered yes or partial – what kind of central heating is there?</b><br><b>(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</b><br><br><b>If you have answered yes, please answer the three questions below:</b> | <b>Yes</b> <input checked="" type="checkbox"/><br><b>No</b> <input type="checkbox"/><br><b>Partial</b> <input type="checkbox"/><br><br>OIL |
|           | <b>i) When was your central heating system or partial central heating system installed?</b>   | NEW BOILER<br>APPROX 5 YEARS   |

# property questionnaire

|    |  |   |
|----|--|---|
|    | <p>(ii) Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p> <p style="text-align: center;">JOHNSTON OIL</p> | <p>Yes <input checked="" type="checkbox"/></p> <p>No <input type="checkbox"/></p>   |
|    | <p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p>  | <p>YEARLY SUPPLY</p>  |
| 8. | Energy Performance Certificate   |   |
|    | <p>Does your property have an Energy Performance Certificate which is less than 10 years old?</p>  | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>   |
| 9. | Issues that may have affected your property  |   |
| a. | <p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>                        | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p> <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p> |
| b. | <p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>   | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>   |



# property questionnaire

|  |  |   |
|--|--|---|
| 10.  | Services   |   |
| a. Please tick which services are connected to your property and give details of the supplier: |  |   |
| Services   | Connected  | Supplier  |
| Gas or liquid petroleum gas  |  |   |
| Water mains or private water supply  | ✓  | Scottish Water  |
| Electricity  | ✓  | SSE   |
| Mains drainage   | ✓  | Scottish Water ?  |
| Telephone  | ✓  | BT  |
| Cable TV or satellite  |  |   |
| Broadband  | ✓  | BT  |
| b.   | Is there a septic tank system at your property?<br>If you have answered yes, please answer the two questions below:  |   |
|  | (i) Do you have appropriate consents for the discharge from your septic tank?  | Yes <input type="checkbox"/><br>No <input type="checkbox"/><br>Don't know <input checked="" type="checkbox"/> |
|  | (ii) Do you have a maintenance contract for your septic tank?<br><br><u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u>   | Yes <input checked="" type="checkbox"/><br>No <input type="checkbox"/><br><br>Scottish Water                  |
| 11.  | Responsibilities for shared or common areas  |   |
| a.   | Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?<br><br><u>If you have answered yes, please give details:</u> | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/><br>Don't know <input type="checkbox"/> |
| b.   | Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?<br><br><u>If you have answered yes, please give details:</u>  | Yes <input type="checkbox"/><br>No <input checked="" type="checkbox"/><br>Don't know <input type="checkbox"/> |
| c.   | Has there been any major repair or replacement of any part of the roof during the time you have owned the property?  | Yes <input checked="" type="checkbox"/><br>No <input type="checkbox"/>  |

# property questionnaire

|     |  |  |
|-----|--|--|
| d.  | <p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>  | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |
| e.  | <p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>  | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |
| f.  | <p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>  | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |
| 12. | <b>Charges associated with your property</b>   |  |
| a.  | <p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>   | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |
| b.  | <p>Is there a common buildings insurance policy?</p> <p><u>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</u></p>  | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p> <p>Don't know <input type="checkbox"/></p> |
| c.  | <p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>  |  |
| 13. | <b>Specialist works</b>  |  |
| a.  | <p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</u></p> | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |
| b.  | <p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes, please give details:</u></p>   | <p>Yes <input type="checkbox"/></p> <p>No <input checked="" type="checkbox"/></p>  |

# property questionnaire

|    |   |  |
|----|---|--|
| c. | <p><b>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</b></p> <p><b>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</b></p> <p><b>Guarantees are held by:</b></p> | <p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input type="checkbox"/></p> |
|    |   |  |

|            |  |                                     |                          |                          |   |                          |
|------------|--|-------------------------------------|--------------------------|--------------------------|---|--------------------------|
| <b>14.</b> | <b>Guarantees</b>  |                                     |                          |                          |   |                          |
| a.         | <b>Are there any guarantees or warranties for any of the following:</b>  |                                     |                          |                          |   |                          |
|            |  | <b>No</b>                           | <b>Yes</b>               | <b>Don't know</b>        | <b>With title deeds</b>   | <b>Lost</b>              |
| (i)        | Electrical work  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (ii)       | Roofing  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (iii)      | Central heating  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (iv)       | National House Building Council (NHBC)   | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (v)        | Damp course  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| (vi)       | Any other work or installations?<br>(for example, cavity wall insulation, underpinning, indemnity policy)  | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/>  | <input type="checkbox"/> |
| b.         | <b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>                         |                                     |                          |                          |   |                          |
| c.         | <p><b>Are there any outstanding claims under any of the guarantees listed above?</b></p> <p><b>If you have answered yes, please give details:</b></p>                  |                                     |                          |                          | <p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input checked="" type="checkbox"/></p>   |                          |
| <b>15.</b> | <b>Boundaries</b>  |                                     |                          |                          |   |                          |
|            | <p><b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b></p> <p><b>If you have answered yes, please give details:</b></p> |                                     |                          |                          | <p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input checked="" type="checkbox"/></p> <p><b>Don't know</b> <input type="checkbox"/></p> |                          |
| <b>16.</b> | <b>Notices that affect your property</b>   |                                     |                          |                          |   |                          |
|            | <b>In the past three years have you ever received a notice:</b>  |                                     |                          |                          |   |                          |
| a.         | <b>advising that the owner of a neighbouring property has made a planning application?</b>   |                                     |                          |                          | <p><b>Yes</b> <input type="checkbox"/></p> <p><b>No</b> <input checked="" type="checkbox"/></p>   |                          |



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

**BRENLYN, HILLHOUSES, DUNDEE, DD3 0PX**

**Dwelling type:** Detached bungalow  
**Date of assessment:** 16 March 2020  
**Date of certificate:** 17 March 2020  
**Total floor area:** 97 m<sup>2</sup>  
**Primary Energy Indicator:** 313 kWh/m<sup>2</sup>/year

**Reference number:** 9110-1627-1200-0026-2292  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, oil

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

|  |               |  |
|--|---------------|--|
| <b>Estimated energy costs for your home for 3 years*</b> | <b>£3,924</b> | See your recommendations report for more information |
| <b>Over 3 years you could save*</b>                      | <b>£1,383</b> |  |

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Not energy efficient - higher running costs

| Current | Potential |
|---------|-----------|
| 46      | 95        |

## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (46)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO<sub>2</sub> emissions



Not environmentally friendly - higher CO<sub>2</sub> emissions

| Current | Potential |
|---------|-----------|
| 39      | 85        |

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (39)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

| Recommended measures                      | Indicative cost | Typical savings over 3 years |
|---|-----------------|------------------------------|
| 1 Flat roof or sloping ceiling insulation | £850 - £1,500   | £939.00                      |
| 2 Cavity wall insulation                  | £500 - £1,500   | £336.00                      |
| 3 Solar water heating                     | £4,000 - £6,000 | £108.00                      |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element               | Description                                    | Energy Efficiency | Environmental |
|-----------------------|--|-------------------|---------------|
| Walls                 | Cavity wall, as built, no insulation (assumed) | ★★☆☆☆             | ★★☆☆☆         |
| Roof                  | Flat, limited insulation (assumed)             | ★☆☆☆☆             | ★☆☆☆☆         |
| Floor                 | Suspended, insulated                           | —                 | —             |
| Windows               | Fully double glazed                            | ★★★★☆             | ★★★★☆         |
| Main heating          | Boiler and radiators, oil                      | ★★★★☆             | ★★★★☆         |
| Main heating controls | Programmer, room thermostat and TRVs           | ★★★★☆             | ★★★★☆         |
| Secondary heating     | None   | —                 | —             |
| Hot water             | From main system                               | ★★★★☆             | ★★★★☆         |
| Lighting              | Low energy lighting in all fixed outlets       | ★★★★★             | ★★★★★         |

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 83 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 5.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.


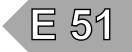







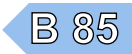
## Estimated energy costs for this home

|               | Current energy costs | Potential energy costs | Potential future savings  |
|---------------|----------------------|------------------------|---|
| Heating       | £3,162 over 3 years  | £1,884 over 3 years    |  |
| Hot water     | £543 over 3 years    | £438 over 3 years      |   |
| Lighting      | £219 over 3 years    | £219 over 3 years      |   |
| <b>Totals</b> | <b>£3,924</b>        | <b>£2,541</b>          |   |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures                      | Indicative cost   | Typical saving per year | Rating after improvement  |   |
|---|-------------------|-------------------------|---|---|
|   |                   |                         | Energy  | Environment   |
| 1 Flat roof or sloping ceiling insulation | £850 - £1,500     | £313                    |  |  |
| 2 Cavity wall insulation                  | £500 - £1,500     | £112                    |  |  |
| 3 Solar water heating                     | £4,000 - £6,000   | £36                     |  |  |
| 4 Solar photovoltaic panels, 2.5 kWp      | £3,500 - £5,500   | £296                    |  |  |
| 5 Wind turbine                            | £15,000 - £25,000 | £653                    |  |  |

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 5 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to [www.energysavingtrust.org.uk/scotland/rhi](http://www.energysavingtrust.org.uk/scotland/rhi).

| Heat demand                  | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 19,806            | N/A                       | (1,946)                          | N/A                             |
| Water heating (kWh per year) | 3,409             |                           |                                  |                                 |

## Addendum

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

|                             |  |
|-----------------------------|--|
| Assessor's name:            | Mr. Malcolm Donald                                     |
| Assessor membership number: | EES/016129   |
| Company name/trading name:  | Graham & Sibbald                                       |
| Address:                    | 1 Greenmarket<br>Dundee<br>DD1 4QB                     |
| Phone number:               | 01382 200064   |
| Email address:              | <a href="mailto:dundee@g-s.co.uk">dundee@g-s.co.uk</a> |
| Related party disclosure:   | No related party                                       |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).



### **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



# Single Survey

survey report on:

|                    |  |
|--------------------|--|
| Property address   | Brenlyn Hillhouses<br>Dundee<br>DD3 0PX  |
| Customer           | Mrs Mary Craib   |
| Customer address   | c/o Thorntons Property Services<br>Whitehall House<br>33 Yeaman Shore<br>Dundee<br>DD1 4BJ |
| Prepared by        | Graham & Sibbald   |
| Date of inspection | 16th March 2020  |

**GRAHAM + SIBBALD**

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;



- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

|  |   |
|--|---|
| <b>Description</b>                               | The subject comprise a detached single storey bungalow.   |
| <b>Accommodation</b>                             | Ground Floor: Entrance Vestibule; Hallway; Lounge; Master Bedroom with en-suite Shower Room with WC; 2 additional Bedrooms; Conservatory; Kitchen and Family Shower Room with W.C.  |
| <b>Gross internal floor area (m<sup>2</sup>)</b> | 105 square metres or thereby.   |
| <b>Neighbourhood and location</b>                | <p>The subjects are situated within a rural location to the north of Dundee. Access to the subjects is via an unmade private track. The former Strathmartine Hospital is located approximately quarter-of-a-mile to the south.</p> <p>Excellent amenities are available within Dundee city.</p> |
| <b>Age</b>                                       | Understood to have been erected circa 1970.   |
| <b>Weather</b>                                   | Dry and clear.  |
| <b>Chimney stacks</b>                            | None  |
| <b>Roofing including roof space</b>              | <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p>The roof is of flat design presumably laid in mineral felt (no inspection made).</p>  |

# Single Survey

|  |  |
|--|--|
| <b>Rainwater fittings</b>                  | <p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The rainwater goods serving the property are of PVC design.</p>  |
| <b>Main walls</b>                          | <p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls of the property would appear to be of cavity brick construction externally harled with facing brick footings.</p>  |
| <b>Windows, external doors and joinery</b> | <p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows are predominantly of uPVC casement double glazed design with fixed pane sections also.</p> <p>Access to the property is via a uPVC double glazed door to the rear with aluminium double glazed patio doors leading from the lounge into the conservatory.</p> |
| <b>External decorations</b>                | <p><b>Visually inspected.</b></p> <p>PVC finish to windows and doors.</p>  |
| <b>Conservatories / porches</b>            | <p><b>Visually inspected.</b></p> <p>The conservatory would appear to be of brick base with uPVC double glazed upper sections whilst the roof is of pitched Perspex design. There are uPVC double glazed doors leading from the conservatory into the garden.</p>  |
| <b>Communal areas</b>                      | <p><b>Circulation areas visually inspected.</b></p> <p>Access to the property is via a shared private unmade track.</p>  |
| <b>Garages and permanent outbuildings</b>  | <p><b>Visually inspected.</b></p> <p>There is a single garage pertaining to the property of concrete sectional design with the roof over being of pitched design appearing to be laid in cement corrugated asbestos panels.</p> <p>Outbuildings comprise a timber shed.</p>  |



# Single Survey

|  |   |
|--|---|
| <b>Outside areas and boundaries</b>          | <p><b>Visually inspected.</b></p> <p>There are garden grounds to the front, side and rear. These are predominantly laid in grass. Boundaries are of concrete block and timber and post design.</p>  |
| <b>Ceilings</b>                              | <p><b>Visually inspected from floor level.</b></p> <p>The ceilings would appear to be of timber stud design overlaid in plasterboard, plastered and painted with timber cladding to the ceiling within the en-suite shower room and Vinyl cladding within the shower room.</p>  |
| <b>Internal walls</b>                        | <p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>The internal partitions would appear to be of brick plastered on the hard as well as timber stud overlaid in plasterboard with the walls partially tiled within the kitchen and wetwalling and tiling within the en-suite and family shower room.</p>   |
| <b>Floors including sub floors</b>           | <p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>The floors within the property are suspended timber construction with fitted floor coverings throughout. There is an external door giving access to the sub floor area however, due to insufficient clearance no full inspection of this area as made. Insulation has been laid below the flooring.</p> |
| <b>Internal joinery and kitchen fittings</b> | <p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>The internal doors are of timber design. There is a fitted kitchen within the property with both base and wall units. There are fitted wardrobes in a number of the bedrooms and cupboard accommodation is adequate for a property of this size and type.</p>  |

# Single Survey

|                                    |   |
|------------------------------------|---|
| Chimney breasts and fireplaces     | None  |
| Internal decorations               | <p><b>Visually inspected.</b></p> <p>Papered and painted.</p>   |
| Cellars                            | <p><b>Visually inspected where there was a safe and purpose-built access.</b></p> <p>There is an external store housing the central heating boiler located at ground level. There is also an additional store at first floor level however no inspection of this was made.</p>  |
| Electricity                        | <p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply of electricity with 13 amp power outlets within the main apartments. The electricity consumer unit and meter are located within the hall cupboard.</p>  |
| Gas                                | None  |
| Water, plumbing, bathroom fittings | <p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply of water and the plumbing where seen is of PVC and copper design. A stainless steel sink unit has been installed within the kitchen with the shower rooms both being on modern white lines.</p>  |
| Heating and hot water              | <p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a full oil fired central heating system within the property with radiators located in the main apartments. Where seen the central heating piping is of copper design with the radiators benefiting from individual thermostatic controls.</p> <p>Domestic hot water would appear to be provided via the central heating system with the boiler being of a Worcester Greenstar wall-mounted design. The oil tank is of modern design located to the rear of the site. We understand that the central heating system was installed approximately 5 years ago. We were also informed that the central heating system is covered by a service contract. No documentation was sighted at the time of inspection.</p> |

## Single Survey

|  |   |
|--|---|
| <b>Drainage</b>                            | <p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage is understood to be connected to an exclusive septic tank. This was not checked or tested.</p>   |
| <b>Fire, smoke and burglar alarms</b>      | <p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There are smoke alarms fitted within the property.</p>   |
| <b>Any additional limits to inspection</b> | <p>The property was fully furnished at the time of our inspection and the services were not tested.</p> <p>No full access was obtained to sub-floor areas.</p> <p>No inspection was made of the flat roof.</p> <p>Due to fitted carpets and floor coverings no detailed inspection was possible of the floor timbers and accordingly we cannot guarantee their soundness or otherwise.</p> <p>It is outwith the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.</p> <p>No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or neighbouring properties.</p> |

## Sectional Diagram showing elements of a typical house




Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey

## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:


| Category 3   | Category 2  | Category 1                               |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

|  Structural movement |  |
|---|--|
| Repair category   | 1  |
| Notes   | At the time of our inspection there was no evidence of significant structural movement noted to affect the property within the limits of our inspection. |

|  Dampness, rot and infestation |  |
|--|--|
| Repair category  | 1  |
| Notes  | There was no evidence found of significant dampness, rot or infestation within those areas of the property available for inspection. |


|  Chimney stacks |                |
|--|----------------|
| Repair category  | -              |
| Notes  | Not applicable |


|  Roofing including roof space |  |
|--|--|
| Repair category  | 2  |
| Notes  | It is understood that the flat roof was renewed in 2008. It should however be appreciated that any flat roof has a limited life and will require regular maintenance and eventual renewal. In line with good practice the roof coverings should be inspected to ascertain current condition. |


|  Rainwater fittings |  |
|--|--|
| Repair category  | 1  |
| Notes  | At the time of our inspection there was no evidence of damp staining/water staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection. |





# Single Survey

|   |   |
|---|---|
|  <b>Main walls</b> |   |
| <b>Repair category</b>  | 2   |
| <b>Notes</b>  | <p>There are areas of bossed and cracked harling as well as cracking to the render around the window margins. Pointing works will be required to prevent water ingress.</p> <p>The main walls would appear to be of cavity brick design however this should be confirmed prior to purchase.</p> |

|  |   |
|--|---|
|  <b>Windows, external doors and joinery</b> |   |
| <b>Repair category</b>   | 1   |
| <b>Notes</b>   | <p>The windows would appear to have been installed in excess of 20 years ago. As stated previously evidence of crazing/cracking was noted to the render around the window margins and re-facing works should be anticipated in the short term. There is evidence of some condensation around some of the window frames.</p> <p>Windows can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance/repair will be required as part of an ongoing maintenance programme.</p> |

|   |   |
|---|---|
|  <b>External decorations</b> |   |
| <b>Repair category</b>  | 1   |
| <b>Notes</b>  | <p>The external decorations are generally in fair order. Regular repainting will be required if these areas are to be maintained in satisfactory condition.</p> |

|   |   |
|---|---|
|  <b>Conservatories/porches</b> |   |
| <b>Repair category</b>  | 1   |
| <b>Notes</b>  | <p>The conservatory is of a lightweight construction type. Accordingly insulation qualities may be limited and the structure will require a degree of regular, ongoing maintenance.</p> <p>We would highlight that it was not raining at the time of inspection and the conservatory should be checked during heavy rainfall.</p> |

|   |   |
|---|---|
|  <b>Communal areas</b> |   |
| <b>Repair category</b>  | 2   |
| <b>Notes</b>  | <p>Access to the property is via an unmade track. The applicants legal advisor should ascertain liability for repair as well as confirming a right of access.</p> |



## Garages and permanent outbuildings

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | <p>The garage may contain materials with an asbestos content including the roof coverings. These have not been tested and we have not carried out an asbestos survey on the garage. However these materials should be handled by a competent contractor only.</p> <p>The downpipe from the garage discharges directly onto the garden ground. This is not good building practice.</p> |



## Outside areas and boundaries

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 2   |
| <b>Notes</b>           | Evidence of decay was notes to the steps/decking area. Inspect and repair as necessary. |



## Ceilings

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | No immediate action or repair would appear necessary. |



## Internal walls

|                        |   |
|------------------------|---|
| <b>Repair category</b> | 1   |
| <b>Notes</b>           | No immediate action or repair would appear necessary. |



## Floors including sub-floors

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | <p>Fitted floor coverings greatly restricted the inspection of the flooring.</p> <p>Limited inspection only of the sub floor area due insulation and contents as well as restricted head room.</p> |



## Internal joinery and kitchen fittings

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | The internal joinery is generally good however some wear and tear items were noted to kitchen units etc., and future maintenance or upgrading should be anticipated. |

# Single Survey



## Chimney breasts and fireplaces

|                 |                |
|-----------------|----------------|
| Repair category | -              |
| Notes           | Not applicable |



## Internal decorations

|                 |  |
|-----------------|--|
| Repair category | 1  |
| Notes           | The external decorations are generally in fair order. Regular repainting will be required if these areas are to be maintained in satisfactory condition. |



## Cellars

|                 |                |
|-----------------|----------------|
| Repair category | -              |
| Notes           | Not applicable |



## Electricity

|                 |  |
|-----------------|--|
| Repair category | 2  |
| Notes           | <p>The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every ten years and on a change of ownership. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.</p> <p>The electricity system may have original sections and accordingly it is recommended that it be inspected and upgraded as necessary.</p> |



## Gas

|                 |                |
|-----------------|----------------|
| Repair category | -              |
| Notes           | Not applicable |



## Water, plumbing and bathroom fittings

|                 |   |
|-----------------|---|
| Repair category | 1   |
| Notes           | The sanitary fittings are of modern style and type. |



## Heating and hot water

|                 |  |
|-----------------|--|
| Repair category | 1  |
| Notes           | There is a gas fired central heating system and gas fittings and these should all be checked and serviced in the normal manner. We have been informed by the |

## Single Survey

|  |  |
|--|--|
|  | current owner that the system was installed approximately 5 years ago and all relevant documentation should be obtained. We were also informed that there is a service contractor over the system and accordingly, again, all documentation should be obtained to confirm this. In line with our usual practice if documentation is not available or not in order the system should be inspected to ascertain current condition. |
|--|--|



### Drainage

|                        |  |
|------------------------|--|
| <b>Repair category</b> | 1  |
| <b>Notes</b>           | Drainage, we understand is to a septic tank. This was not checked or tested. It should be ensured that appropriate registration documents are available. |

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

|                                       |   |
|---------------------------------------|---|
| Structural movement                   | 1 |
| Dampness, rot and infestation         | 1 |
| Chimney stacks                        | - |
| Roofing including roof space          | 2 |
| Rainwater fittings                    | 1 |
| Main walls                            | 2 |
| Windows, external doors and joinery   | 1 |
| External decorations                  | 1 |
| Conservatories/porches                | 1 |
| Communal areas                        | 2 |
| Garages and permanent outbuildings    | 2 |
| Outside areas and boundaries          | 2 |
| Ceilings                              | 1 |
| Internal walls                        | 1 |
| Floors including sub-floors           | 1 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces        | - |
| Internal decorations                  | 1 |
| Cellars                               | - |
| Electricity                           | 2 |
| Gas                                   | - |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water                 | 1 |
| Drainage                              | 1 |

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

|  |   |
|--|---|
| 1. Which floor(s) is the living accommodation on?                                      | Ground  |
| 2. Are there three steps or fewer to a main entrance door of the property?             | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property?                          | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 4. Are all door openings greater than 750mm?   | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen?                 | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 6. Is there a toilet on the same level as a bedroom?                                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 7. Are all rooms on the same level with no internal steps or stairs?                   | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |



## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that when repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

Access to the property is via a private unmade track. The applicants' legal advisor should the right of access as well as liability for repair.

A conservatory has been added to the front of the property. When these works were carried out is unknown. Confirmation should be made that the subjects are of traditional cavity brick construction.

### Estimated reinstatement cost for insurance purposes

We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £220,000(TWO HUNDRED AND TWENTY THOUSAND POUNDS).

### Valuation and market comments

Market Value assuming vacant possession is £150,000(ONE HUNDRED AND FIFTY THOUSAND POUNDS).

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

|                      |   |
|----------------------|---|
| <b>Signed</b>        | Security Print Code [594906 = 7623 ]<br>Electronically signed |
| <b>Report author</b> | Graham Tonner   |
| <b>Company name</b>  | Graham & Sibbald  |
| <b>Address</b>       | 1 Greenmarket, Dundee, DD1 4QB                                |

# Single Survey

|                |                |
|----------------|----------------|
| Date of report | 2nd April 2020 |
|----------------|----------------|

# Mortgage Valuation Report

**GRAHAM + SIBBALD**

## Property Address

Address Brenlyn Hillhouses, Dundee, DD3 0PX  
Seller's Name Mrs Mary Craib  
Date of Inspection 16th March 2020

## Property Details

Property Type ☐ House ☒ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette  
☐ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use  
☐ Other (specify in General Remarks)

Property Style ☒ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace  
☐ Back to back ☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided? ☐ Yes ☐ No  
No. of units in block

Approximate Year of Construction

## Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

## Garage / Parking / Outbuildings

☒ Single garage ☐ Double garage ☐ Parking space ☐ No garage / garage space / parking space  
Available on site? ☐ Yes ☐ No

Permanent outbuildings:

None

# Mortgage Valuation Report

## Construction

Walls ☒ Brick ☐ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)  
Roof ☐ Tile ☐ Slate ☐ Asphalt ☒ Felt ☐ Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement? ☐ Yes ☒ No

If Yes, is this recent or progressive? ☐ Yes ☐ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☐ Mains ☒ Private ☐ None Water ☒ Mains ☐ Private ☐ None  
Electricity ☒ Mains ☐ Private ☐ None Gas ☐ Mains ☐ Private ☒ None  
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Full oil fired central heating system to radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☒ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections  
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

## Location

☐ Residential suburb ☐ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial  
☐ Commuter village ☐ Remote village ☒ Isolated rural property ☐ Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered? ☒ Yes ☐ No

If Yes provide details in General Remarks.

## Roads

☐ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☐ Adopted ☒ Unadopted

# Mortgage Valuation Report

## General Remarks

The subjects comprise a detached single storey bungalow situated to the north of Dundee in a semi rural location. Access to the property is via an unmade track. The former Strathmartine Hospital is located approximately quarter-of-a-mile south of the subjects.

Excellent amenities are available within Dundee city.

Internally, fixtures and fittings are on modern lines and decoration is generally to a good standard throughout. During our inspection defects were noted which are commonly found in a property of this type and age and should be capable of remedy by maintenance and repair. No inspection was made of the flat roof over the subjects and accordingly no comment can be made as to its condition. Defects were noted which are commonly found in a property of this type and age and should be capable of remedy by maintenance and repair. Confirmation should be made that the subjects are of traditional cavity brick construction.

## Essential Repairs

None

Estimated cost of essential repairs £  Retention recommended? ☐ Yes ☐ No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

As lenders' requirements differ you should confirm with your mortgage provider the subjects meet their lending criteria.

## Valuations

|   |   |
|---|---|
| Market value in present condition   | £ 150,000   |
| Market value on completion of essential repairs   | £ n/a   |
| Insurance reinstatement value<br>(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) | £ 220,000   |
| Is a reinspection necessary?  | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |

## Buy To Let Cases

|   |  |
|---|--|
| What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? | £ N/A  |
| Is the property in an area where there is a steady demand for rented accommodation of this type?                                    | <input type="checkbox"/> Yes <input type="checkbox"/> No |

## Declaration

|                             |  |
|-----------------------------|--|
| Signed                      | Security Print Code [594906 = 7623 ]<br>Electronically signed by:- |
| Surveyor's name             | Graham Tonner  |
| Professional qualifications | MRICS  |
| Company name                | Graham & Sibbald   |
| Address                     | 1 Greenmarket, Dundee, DD1 4QB                                     |
| Telephone                   | 01382 200064   |
| Fax                         | 01382 229773   |
| Report date                 | 2nd April 2020   |