

Home report



thorntons-property.co.uk

Thorntons is a trading name of Thorntons Law LLP

P A R T 4.

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address	Denview Cottage Balconnel Menmuir, Brechin DD9 7RW
Seller(s)	Alan Quirie
Completion date of property questionnaire	07082019

Note for sellers

1.	Length of ownership		
	How long have you owned the 31.5yrs	property?	\$50,
2.	Council tax		
	Which Council Tax band is yo []A []B []C [x]D []E []F []G []		
3.	Parking		
	What are the arrangements fo (Please tick all that apply)	r parking at your property?	
	Garage	[]	
	Allocated parking space	[]	
	Driveway	[x]	
	Shared parking	[]	
	On street	[]	
	Resident permit	[]	
	Metered parking	[1	
	Other (please specify):		

4.	Conservation area		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[x]YES []NO []Don't know	
5.	Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[]YES [x]NO	
6.	Alterations/additions/extensions		
а	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[x]YES []NO	
	If you have answered yes, please describe below the changes which you have made:	CX	
	Added en suite.	2	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[]YES [x]NO	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.		
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:		
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[x]YES []NO	
	If you have answered yes, please answer the three questions below:	N.	
	(i) Were the replacements the same shape and type as the ones you replaced?	[]YES [x]NO	
	(ii) Did this work involve any changes to the window or door openings?	[x]YES []NO	
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):		
	Sash windows changed.		

	Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
а	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[x]YES []NO []Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	electric storage heaters	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?	
	when we bought it	
	(ii) Do you have a maintenance contract for the central heating system?	[]YES [x]NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	•
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	[x]YES []NO
9.	Issues that may have affected your property	
а	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	[x]YES []NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[]YES [x]NO
b	Are you aware of the existence of asbestos in your property?	[]YES [x]NO []Don't know
b		

	Services	Connected	Supplie	r
	Gas or liquid petroleum gas	N		
	Water mains or private water supply	Y	mains	0
	Electricity	Y	hydro	
	Mains drainage	Y	private	shared
	Telephone	Y	landline	;
	Cable TV or satellite	N		
	Broadband	Υ	bt	
	Is there a septic tank system at your prope	erty?	[x]YE	S []NO
	If you have answered yes, please answer below:	the two questions		0
				S []NO
	(ii) Do you have a maintenance contract fo	or your septic tank?	[]YE	S [x]NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:			
Responsibilities for shared or common areas				
	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		[]YE	S [x]NO n't know
	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		e []YE:	S [x]NO
	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		[]YE	S [x]NO
	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		ı []YE	S [x]NO
	, ,,	eighbours have the		

	right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privatelyowned.) If you have answered yes, please give details:	[]YES [x]NO
12.	Charges associated with your property	
а	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[]YES [x]NO
b	Is there a common buildings insurance policy?	[]YES [x]NO []Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
С	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	R
13.	Specialist works	
а	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please give details:	
С	If you have answered yes to 13(a) or (b), do you have any	[]YES []NO
	guarantees relating to this work?	

14.	Guarantees		
а	Are there any guarantees or warranties for any of the following:		
(i)	Electrical work	[x]NO []YES []Don't know []With title deeds []Lost	
(ii)	Roofing	[x]NO []YES []Don't know []With title deeds []Lost	
(iii)	Central heating	[x]NO []YES []Don't know []With title deeds []Lost	
(iv)	National House Building Council(NHBC)	[x]NO []YES []Don't know []With title deeds []Lost	
(v)	Damp course [x]NO []YES []Don't know []With title deeds []Los		
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) [x]NO []YES []Don't know []With title deeds []Lo		
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):		
С	Are there any outstanding claims under any of the guarantees listed above?	[]YES [x]NO	
	If you have answered yes, please give details:		

15.	Boundaries		
	So far as you are aware, has any boundary of your property been moved in the last 10 years? []YES [x]NO []Don't know		
	If you have answered yes, please give details:	•	
16.	Notices that affect your property		
In the	In the past three years have you ever received a notice:		
а	advising that the owner of a neighbouring property has made a planning application?	[]YES [x]NO	
b	that affects your property in some other way?	[]YES [x]NO	

property questionnaire

С	that requires you to do any maintenance, repairs or improvements to your property?	[]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

	the seller(s)/or other authorised body or person(s) I/We confirm ation in this form is true and correct to the best of my/our belief.
Signature(s):	alan quirie
Capacity:	[x]Owner []Legally Appointed Agent for Owner
Date:	07082019
	RPC)

Energy Performance Certificate (EPC)

Dwellings

Scotland

DENVIEW, MENMUIR, BRECHIN, DD9 7RW

Dwelling type: Detached bungalow
Date of assessment: 30 July 2019
Date of certificate: 02 August 2019

Total floor area: 125 m²

Primary Energy Indicator: 910 kWh/m²/year

Reference number: 7811-9923-4000-0740-5976 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Electric storage heaters

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£10,968	See your recommendations
Over 3 years you could save*	£6,627	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

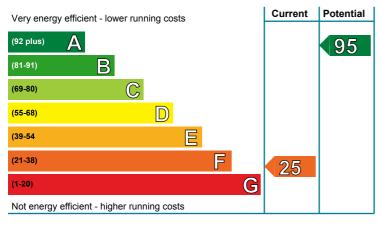


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band F (25)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

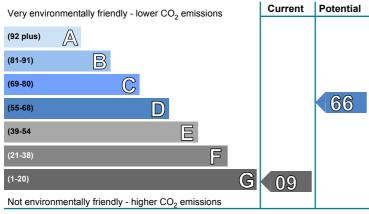

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band G (9)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£850 - £1,500	£1074.00
2 Cavity wall insulation	£500 - £1,500	£399.00
3 Internal or external wall insulation	£4,000 - £14,000	£1656.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
	Cavity wall, as built, no insulation (assumed)	****	$\star\star$
Roof	Pitched, 300 mm loft insulation	****	****
	Flat, no insulation (assumed)	****	****
Floor	Suspended, no insulation (assumed)	_	_
	Solid, no insulation (assumed)	_	_
Windows	Fully double glazed	****	★★★ ☆
Main heating	Electric storage heaters	***	****
Main heating controls	Manual charge control	***	***
Secondary heating	Room heaters, dual fuel (mineral and wood)	_	_
Hot water	Electric immersion, off-peak	***	***
Lighting	Low energy lighting in 69% of fixed outlets	****	★★★ ☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 160 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 20 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 14.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£8,910 over 3 years	£3,687 over 3 years	
Hot water	£1,698 over 3 years	£378 over 3 years	You could
Lighting	£360 over 3 years	£276 over 3 years	save £6,627
Totals	£10,968	£4,341	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Flat roof or sloping ceiling insulation	£850 - £1,500	£358	F 30	G 14
2	Cavity wall insulation	£500 - £1,500	£133	F 32	G 16
3	Internal or external wall insulation	£4,000 - £14,000	£552	E 42	F 25
4	Floor insulation (suspended floor)	£800 - £1,200	£310	E 49	F 31
5	Floor insulation (solid floor)	£4,000 - £6,000	£131	E 52	F 34
6	Low energy lighting for all fixed outlets	£20	£21	E 52	F 34
7	High heat retention storage heaters and dual immersion cylinder	£2,000 - £3,000	£639	D 68	E 43
8	Solar water heating	£4,000 - £6,000	£66	C 69	E 46
9	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£306	C 77	E 52
10	Wind turbine	£15,000 - £25,000	£675	A 95	D 66

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation
- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

4 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

5 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

6 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

7 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

8 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

9 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

10 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	32,751	N/A	(1,466)	(6,008)
Water heating (kWh per year)	3,584			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Angus Carruthers

Assessor membership number: EES/014058
Company name/trading name: J & E Shepherd
Address: 12 Atholl Crescent

Edinburgh EH3 8HA

Phone number: 0131 225 1234

Email address: edinburgh@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



survey report on:

Property address Denvie Menm Brechi DD9 7	uir n
Customer Mr A.	Quirie
Customer address Denvie Balcor Menm Brechi DD9 7	uir n
Prepared by J & E s	Shepherd
Date of inspection 14th J	uly 2020



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a Detached Bungalow extended to the rear.
Accommodation	Ground Floor - Entrance Hall, Livingroom, Kitchen, Bathroom with W.C., Utility Room, Master Bedroom with en suite Showerroom and Three Further Bedrooms.
Gross internal floor area (m²)	125 metres squared approximately.
Neighbourhood and location	The subjects are situated within a rural location where surrounding properties are a mixture of agricultural/low density residential use. All amenities can be found within the nearby town of Brechin.
Age	1890 approximately.
Weather	Dry and clear.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimneys are of brick construction pointed externally and incorporating metal flashings.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and


	reasonable to do so.
	reasonable to do so.
	The roof is of pitched timber construction overlaid in slates and incorporating metal ridging. The roofing over both rear extensions is of a flat felt type overlaid in corrugated metal sheeting.
	Access to the roof void over the main building was afforded via the hatch within the hall. Our inspection of this area was limited due to the presence of insulation.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rain water fittings are a mixture of PVC and cast iron construction.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of solid stone construction pointed externally. The walls to the rear extensions appear to be of cavity brick construction roughcast externally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
Windows, external doors and joinery	
Windows, external doors and joinery	keys were available.
Windows, external doors and joinery	keys were available. Random windows were opened and closed where possible.
	Random windows were opened and closed where possible. Doors and windows were not forced open. The windows within the property are of PVC casement type incorporating sealed unit double glazing. The main entrance door is of a timber type.
Windows, external doors and joinery External decorations	Random windows were opened and closed where possible. Doors and windows were not forced open. The windows within the property are of PVC casement type incorporating sealed unit double glazing. The main entrance door
	Random windows were opened and closed where possible. Doors and windows were not forced open. The windows within the property are of PVC casement type incorporating sealed unit double glazing. The main entrance door is of a timber type.
	Random windows were opened and closed where possible. Doors and windows were not forced open. The windows within the property are of PVC casement type incorporating sealed unit double glazing. The main entrance door is of a timber type. Visually inspected.
External decorations	keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows within the property are of PVC casement type incorporating sealed unit double glazing. The main entrance door is of a timber type. Visually inspected. Painted and PVC finishes.
External decorations Conservatories / porches	Random windows were opened and closed where possible. Doors and windows were not forced open. The windows within the property are of PVC casement type incorporating sealed unit double glazing. The main entrance door is of a timber type. Visually inspected. Painted and PVC finishes. None.
External decorations Conservatories / porches	keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows within the property are of PVC casement type incorporating sealed unit double glazing. The main entrance door is of a timber type. Visually inspected. Painted and PVC finishes. None.

Outside areas and boundaries	Visually inspected.
	The subjects benefit from garden ground to the front and rear. The boundaries where defined are in timber fencing and post and wire fencing.
Ceilings	Visually inspected from floor level.
	The ceilings appear to be finished in plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls appear to be finished in plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floors are a mixture of suspended timber and solid concrete construction. Fitted floor coverings were present throughout. No access was afforded to any sub floor areas.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal joinery finish is in softwood throughout and the kitchen has been fitted with wall and base units. Internal doors are of a timber panel/flush veneer type.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	An open fire is present within the livingroom.
Internal decorations	Visually inspected.
	Painted and wallpapered finishes.

Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. 13 amp mains supply with circuit breakers/fusebox located within the entrance hall. Our valuation presumes there are no additional repayments levied via the electricity bill in respect of energy efficiency measures funded by the Green Deal. At present there is limited market evidence to demonstrate whether Green Deal funding has any impact on value or future saleability.
Gas	No mains gas supply installed.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Mains water supply installed. Supply pipes where seen appear to be of a copper type. The sanitary arrangements comprise a three piece suite within the bathroom and a two piece suite and shower within the en suite.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. The subjects benefit from an electric storage heating system. Domestic hot water is provided via an electric immersion heater with the hot water cylinder located within the roof void. Our inspection of the hot water cylinder was severely restricted due to its location.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Waste drainage we understand is to a shared septic tank system located within the garden ground of a neighbouring property. Rain water drainage is assumed to be to a soakaway system. The systems were not tested.

Fire, smoke and burglar alarms	None noted.
Any additional limits to inspection	No access was afforded to the sub floor area and the internal inspection was restricted due to fitted floor coverings. The subjects were fully furnished at the time of inspection. The cupboards/rooms were full of possessions at the time of inspection. A limited inspection of the roof void was carried out due to the presence of possessions and insulation. No access was afforded to the areas below or beyond the sanitary arrangements. The windows and doors were tested at random. Damp meter readings were taken at random. The central heating system was not tested. Roof decks and chimneys were viewed from ground floor level only.
	An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

Sectional Diagram showing elements of a typical house

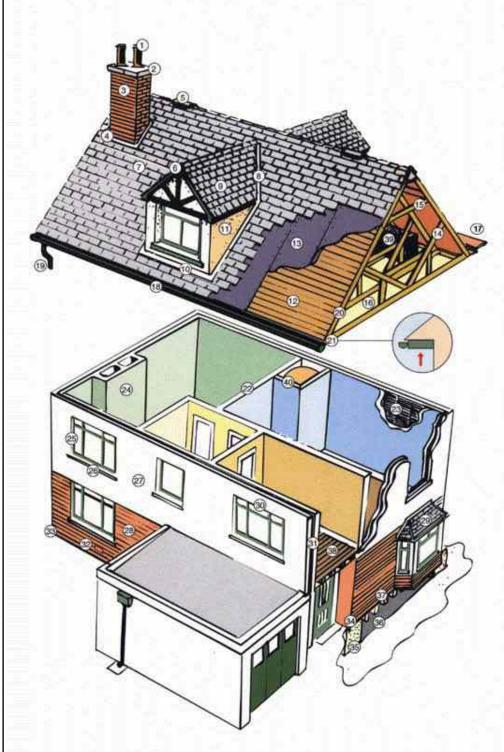

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- (2) Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 7) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- O Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- S
- (26) Window sills
- (27) Rendering
- (28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37 Floor joists
- 38) Floorboards
- Water tank
- (40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movemen	nt
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	2
Notes	High moisture readings were recorded to sections of the lower walls within the utility extension and to the walls adjacent to the shower within the en suite. We would recommend a precautionary check of the entire subjects prior to purchase by a qualified timber and damp proofing specialist with all necessary remedial works to be carried out thereafter.

Chimney stacks	
Repair category	1
Notes	Chimney stacks appear to be in a fair state of repair within the limitations of our inspection but can be vulnerable to defect and should be regularly maintained.

Roofing including roof space	
Repair category	2
Notes	Chipped and slipped slates noted. Roof coverings are of an age and style where a degree of regular ongoing maintenance should be anticipated. More extensive overhaul work may be required in future. The flat roof sections over the rear extensions will have a limited life span and ongoing maintenance/repair should be anticipated.

Rainwater fittings	
Repair category	2
Notes	Corrosion and vegetation noted to sections of the rain water fittings. Ongoing maintenance/repair should be anticipated.

Main walls	
Repair category	2
Notes	Isolated sections of cracked roughcast noted to the kitchen extension. Remedial works will be required.

Windows, external doors and joinery	
Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	-
Notes	None.

Communal areas	
Repair category	-
Notes	None.

Garages and permanent outbuildings	
Repair category	3
Notes	The timber lean to is in very poor condition and will require either extensive overhaul or demolition. Furthermore additional outbuildings were also found to be in an advanced state of disrepair and remedial works will be required.

Outside areas and boundaries	
Repair category	2
Notes	General maintenance required to garden ground. A number of possessions were noted within the garden ground. We would recommend that these be removed in accordance with good practice.

Ceilings	
Repair category	2
Notes	Polystyrene tiles noted within the kitchen and utility rooms. Localised damage noted to sections of the ceilings. Remedial works will be required.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Deterioration noted to seals around the kitchen sink. Remedial works will be required.

Chimney breasts and fireplaces	
Repair category	1
Notes	All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused.

Internal decorations	
Repair category	1
Notes	The property is in fair decorative order only, and would benefit from a programme of redecoration.

Cellars	
Repair category	-
Notes	None.

Electricity	
Repair category	2
Notes	Aspects of the electrical installation are dated and the system should be checked as a precaution by a registered electrician and upgraded if necessary. The Institute of Engineering and Technology recommends that inspections and testings are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with present IET regulations.

Gas	
Repair category	-
Notes	None.

T- Water, plumbing and bathroom fittings	
Repair category	2
Notes	Deterioration noted to shower seals within the en suite. Dampness noted to the wall adjacent to the shower as noted in the dampness, rot and infestation section. Remedial works will be required.

Heating and hot water	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted. The system was not tested.

Drainage	
Repair category	1
Notes	It should be confirmed that an effective right of servitude is in place with regards to the septic tank. The system was not tested.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	3
Outside areas and boundaries	2
Ceilings	2
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	-
Water, plumbing and bathroom fittings	2
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground	
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No	
3. Is there a lift to the main entrance door of the property?	Yes No X	
4. Are all door openings greater than 750mm?	Yes No X	
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No	
6. Is there a toilet on the same level as a bedroom?	Yes X No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No	
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The subjects have been altered and extended to form the present accommodation. It is presumed that at the time these works were carried out all necessary consents and permissions were obtained and that they are being held safe with the Title Deeds.

It should be confirmed that an effective right of servitude is in place with regards to the septic tank.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

This is a Replacement Home Report following on from our original report dated 30th July 2019.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than THREE HUNDRED AND FIFTY THOUSAND POUNDS (£350,000). This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of ONE HUNDRED AND NINETY FIVE THOUSAND POUNDS (£195,000).

Property market activity has been impacted due to the current response to Covid-19. We are faced with an unprecedented set of circumstances on which to make a valuation judgement. Our advice is therefore reported on the basis of material valuation uncertainty as per the RICS Red Book Global definition. Consequently, less certainty can be attached to our valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

Signed	Security Print Code [417649 = 7764] Electronically signed
Report author	Angus Carruthers
Company name	J & E Shepherd
Address	11 High Street, Montrose, DD10 8LU

Date of report	24th July 2020
----------------	----------------



Property Address				
Address Seller's Name Date of Inspection	Denview, Menmuir, Brechin, DD9 7RW Mr A. Quirie 14th July 2020			
Property Details				
Property Type	House X Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)			
Property Style	X Detached Semi detached Mid terrace End terrace Back to back High rise block Low rise block Other (specify in General Remarks)			
Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?				
Flats/Maisonettes only Approximate Year of 0	No. of units in block			
Tenure				
X Absolute Ownership	Leasehold Ground rent £ Unexpired years			
Accommodation				
Number of Rooms	1 Living room(s) 4 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 2 WC(s) 1 Other (Specify in General remarks)			
Gross Floor Area (excluding garages and outbuildings) 125 m² (Internal) 125 m² (External) Residential Element (greater than 40%) X Yes No				
Garage / Parking / 0	Outbuildings			
Single garage Available on site?	□ Double garage □ Parking space □ Yes X No X No garage / garage space / parking space			
Permanent outbuildings:				
Lean to, timber/meta	al shed, solid stone store and metal shed.			

Construction								
Walls	Brick	X Stone	Conci	rete Timb	per frame	Othe	er (specify in Gen	eral Remarks)
Roof	Tile	X Slate	Aspha	alt Felt		Othe	er (specify in Gen	eral Remarks)
Special Risks								
Has the property	suffered struc	ctural movem	ent?				Yes	X No
If Yes, is this rece	ent or progres	sive?					Yes	No
Is there evidence, immediate vicinity		eason to antic	cipate subside	ence, heave, l	landslip o	r flood in th	e Yes	X No
If Yes to any of th	e above, pro	vide details ir	n General Rer	narks.				
Service Connec	ctions							
Based on visual ir of the supply in G			vices appear t	o be non-mai	ins, pleas	e comment	on the type a	nd location
Drainage	Mains	X Private	None		Water	X Mains	Private	None
Electricity	X Mains	Private	None		Gas	Mains	Private	X None
Central Heating	X Yes	Partial	None					
Brief description of	of Central Hea	ating:						
Electric storage	heating syste	em.						
Site								
Apparent legal iss	sues to be ve	rified by the o	conveyancer.	Please provi	de a brief	f description	in General R	emarks.
Rights of way	Shared dri	ves / access	Garage or o	other amenities o	on separate	site Sha	ared service conn	ections
Ill-defined boundar	ries	Agricu	Iltural land includ	ed with property		Oth	er (specify in Ge	neral Remarks)
Location								
Residential suburb	Re	esidential within	town / city	Mixed residentia	al / commer	cial Mai	nly commercial	
Commuter village	Re	emote village	X	Isolated rural pr	operty	Oth	er (specify in Ge	neral Remarks)
Planning Issues	S							
Has the property I If Yes provide det			d / altered?	X Yes N	0			
Roads								
X Made up road	Unmade roa	ad Parti	y completed new	road P	edestrian a	ccess only	Adopted	Unadopted

General Remarks
The subjects are situated within a rural location where surrounding properties are a mixture of agricultural/low density residential use. All amenities can be found within the nearby town of Brechin.
It should be confirmed that an effective right of servitude us in place with regards to the septic tank.
Faceutial Banaira
Essential Repairs
None.
Estimated cost of essential repairs £ Retention recommended? Yes X No Amount £

Comment on Mortgageability				
The property forms suitable mortgage provider.	le security for mortgage purposes subject to the specific lending criteria o	f any		
Valuations				
Market value in present cor Market value on completion Insurance reinstatement va (to include the cost of total is a reinspection necessary	n of essential repairs lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 195,000 £ £ 350,000		
Buy To Let Cases				
What is the reasonable rangementh Short Assured Tenan	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£		
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No		
Declaration				
Signed	Security Print Code [417649 = 7764] Electronically signed by:-			
Surveyor's name	Angus Carruthers			
Professional qualifications	BSc (Hons), MRICS			
Company name	J & E Shepherd			
Address	11 High Street, Montrose, DD10 8LU			
Telephone	01674 676768			
Fax	01674 678090			
Report date	24th July 2020			