

Home report



thorntons-property.co.uk

Thorntons is a trading name of Thorntons Law LLP

Property address	15 Forest Park Road (TFR) Dundee, DD1 5NZ)
Seller(s)	Williamson Trust
Completion date of property questionnaire	26 06 2020

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership		
	How long have you owned the property? 11 years		
2.	Council tax		
	Which Council Tax band is your property in? (Please tick)		
	A 🛮 B 🗌 C 🔲 D 🔲 E 📗 F 🔲 G 🔲 H 🗎		
3.	Parking		
	What are the arrangements for parking at your property? (Please tick all that apply)		
	• Garage		
	Allocated parking space		
	• Driveway		
	Shared parking		
	● On street		
	Resident permit		
	Metered parking		
	Other (please specify):		
4.	Conservation area		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes No Don't know	
5.	Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes No	
6.	Alterations/additions/extensions		
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes No	

	If you have answered yes, please describe below the changes which you have made:		
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes No	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes No	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes No	
	(ii) Did this work involve any changes to the window or door openings?	Yes No	
		L	
	(iii) Please describe the changes made to the windows doors, or approximate dates when the work was completed): Please give any guarantees which you received for this work to estate agent.		
7.	approximate dates when the work was completed): Please give any guarantees which you received for this work to		
7. a.	approximate dates when the work was completed): Please give any guarantees which you received for this work to estate agent.		
	approximate dates when the work was completed): Please give any guarantees which you received for this work to estate agent. Central heating Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the	your solicitor or Yes	
	approximate dates when the work was completed): Please give any guarantees which you received for this work to estate agent. Central heating Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas	your solicitor or Yes	

	(ii) Do you have a maintenance contract for the central heating system?	Yes No	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).		
8.	Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes No	\boxtimes
9.	Issues that may have affected your property		
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes No	
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes No	
b.	Are you aware of the existence of asbestos in your property?		
	If you have answered yes, please give details:	Yes No	

10.	Services				
a. Ple supplie	ease tick which services are er:	connected to your prope	erty and give o	letails of the	
Servi	ces	Connected	Supplier		
Gas o	r liquid petroleum gas				
	mains or private supply	Water mains	Scottish W	ater?	
Electr	ricity	Yes	SSE		
Mains	s drainage	Yes			
Telep	hone				
Cable	TV or satellite				
Broad	lband				
b.	Is there a septic tank syst If you have answered yes below:		uestions	Yes No	
	(i) Do you have appropriate your septic tank?	te consents for the discha	arge from	Yes No Don't know	
	(ii) Do you have a mainter	nance contract for your se	eptic tank?	Yes No	
	If you have answered yes with which you have a ma				
11.	Responsibilities for share	d or common areas			
a.	Are you aware of any responsible anything used jointly, such road, boundary, or garden	Yes No Don't know			
	If you have answered yes,	please give details:			
b.	Is there a responsibility to the roof, common stairwell	or other common areas?	aintenance of	Yes No Don't know	
	If you have answered yes, As far as i am aware the co in the stair		e propertes		_
C.	Has there been any major r		y part of the	Yes	

d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	Yes No	
	If you have answered yes, please give details:		
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details: There is a garden to which all the occupants of the flats on the	Yes No	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yes No	
	If you have answered yes, please give details:		
12.	Charges associated with your property		
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	Yes No	
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes No Don't know	
C.	Please give details of any other charges you have to pay on a regular upkeep of common areas or repair works, for example to a resident maintenance or stair fund.		r
13.	Specialist works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	Yes No	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	Yes No	

c.	If you have answered yes to 13(a) or (b), d guarantees relating to this work? If you have answered yes, these guarantee purchaser and should be given to your so possible for checking. If you do not have t your solicitor or estate agent will arrange You will also need to provide a description out. This may be shown in the original est Guarantees are held by:	Yes No				
				1		
14.	Guarantees					
a.	Are there any guarantees or warranties for	r any of ti		ng: Don't	With title	
		No	Yes	know	deeds	Lost
(i)	Electrical work	\boxtimes				
(ii)	Roofing					
(iii)	Central heating	\boxtimes				
(iv)	National House Building Council (NHBC)					
(v)	Damp course					
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)					
b.	If you have answered 'yes' or 'with title de installations to which the guarantee(s) rela		ase give o	letails of	the work or	
C.	Are there any outstanding claims under ar listed above?	es	Yes No			
	If you have answered yes, please give deta					
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:					
16.	Notices that affect your property					
	In the past three years have you ever red	ceived a	notice:			
a.	advising that the owner of a neighbourir planning application?	ng propei	rty has m	ade a	Yes No	

b.	that affects your property in some other way?	Yes No	
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes No	
	If you have answered yes to any of a-c above, please give solicitor or estate agent, including any notices which arriv date of entry of the purchaser of your property.		

Declaration by the seller(s)/or other authorised body or person(s

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :		
Date:		

Energy Performance Certificate (EPC)

Dwellings

Scotland

15H FOREST PARK ROAD, DUNDEE, DD1 5NZ

Dwelling type: Top-floor flat
Date of assessment: 27 July 2020
Date of certificate: 28 July 2020

Total floor area: 43 m²

Primary Energy Indicator: 463 kWh/m²/year

Reference number: 8310-3123-7000-0453-4226 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Room heaters, electric

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,636	See your recommendations
Over 3 years you could save*	£2,193	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

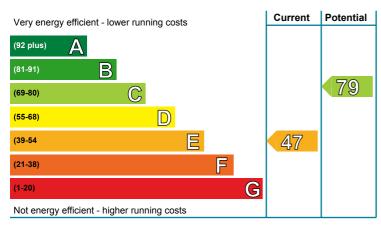


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (47)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

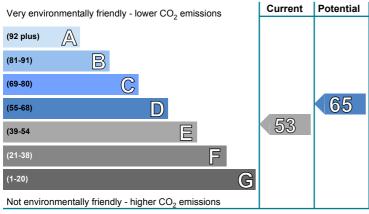

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (53)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£1050.00
2 High heat retention storage heaters	£800 - £1,200	£1143.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
	Solid brick, as built, no insulation (assumed)	****	***
Roof	Pitched, 250 mm loft insulation	****	★★★★ ☆
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	***	***
Main heating	Room heaters, electric	****	***
Main heating controls	Appliance thermostats	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	Electric immersion, standard tariff	***	***
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 78 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.4 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,625 over 3 years	£855 over 3 years	
Hot water	£897 over 3 years	£462 over 3 years	You could
Lighting	£114 over 3 years	£126 over 3 years	save £2,193
Total	s £3,636	£1,443	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Da	commanded massives	lu dinativa nast	Typical saving	Rating after improvement	
Recommended measures		Indicative cost	per year	Energy	Environment
1	Internal or external wall insulation	£4,000 - £14,000	£350	D 62	D 66
2	High heat retention storage heaters and dual immersion cylinder	£800 - £1,200	£381	C 79	D 65

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package





About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 High heat retention storage heaters

Modern storage heaters are less expensive to run than the direct acting, on-peak heating system in the property. A dual-rate electricity supply is required to provide the off-peak electricity that these heaters use; this is easily obtained by contacting the energy supplier. Ask for a quotation for high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the national wiring standards. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified electrical heating engineer. Ask the engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,679	N/A	N/A	(1,872)
Water heating (kWh per year)	1,600			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:
Assessor membership number:
Company name/trading name:
Address:

Mr. Graham Tonner
EES/009482
Graham & Sibbald
1 Greenmarket
Dundee

Phone number: DD1 4QB
O1382 200064
Email address: dundee@g-s.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



survey report on:

Property address	15H Forest Park Road Dundee DD1 5NZ
Customer	Williamson Trust
Customer address	c/o Thorntons Whitehall House 33 Yeaman Shore Dundee DD1 4BJ
Prepared by	Graham & Sibbald
Date of inspection	27th July 2020



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose-built, self-contained third floor eastmost flat, part of a four storey mid-terraced tenement building containing eight residential units.
Accommodation	THIRD FLOOR - Hallway, Lounge, Bedroom, Kitchen and Shower Room with WC.
Gross internal floor area (m²)	42 sq m or thereby.
Neighbourhood and location	The property is located approximately one mile west of Dundee City Centre within a mixed, mainly residential district. Adequate secondary shopping, public transport, social and educational facilities can be found within easy reach. Blackness Fire Station is directly to the rear of the subjects.
Age	Erected around 1900.
Weather	Overcast with rain.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stacks are of solid stone construction served with cement flashings where viewed. A limited view was possible from ground level.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

	The roof is of pitched timber construction, externally clad in slate with zinc ridging. Access to the roof space is via a hatch within the shower room of the property, although due to the height of this hatch a head and shoulders inspection was possible only. The roof space over the property was found to be insulated and this restricted our inspection.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The rainwater goods are of PVC design.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls of the property are of solid stone construction.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows are of UPVC sealed unit double glazed design. Access to the property is via the original timber panelled entry door.
External decorations	Visually inspected.
Conservatories / porches	None.
Communal areas	Circulation areas visually inspected.
	Access to all flats is via a common entrance and stairwell.
Garages and permanent outbuildings	Visually inspected.
	We are unaware of any significant outbuildings pertaining to the property. There are brick and slate cellars within the rear garden and it is understood that one of these pertain to the property (not inspected).

Outside areas and boundaries	Visually inspected.
	There is a mutual rear garden area and this is enclosed with brick and stone walls which are roughcast.
Ceilings	Visually inspected from floor level.
Cennigs	
	The ceilings are of timber lath and plaster and lowered plasterboard design throughout and these have a papered and painted finish.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls are of brick construction plastered on the hard, timber lath and plaster, and timber stud and plasterboard design. Internal surfaces are papered and painted throughout and the walls are partially tiled within the kitchen and partially clad with decorative panelling within the shower room.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No
3	carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	The flooring within is of suspended timber. Due to laminate flooring throughout the property, no inspection of the floor timbers was possible.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors are of original timber panel design. The kitchen units are on older lines. Storage accommodation within is limited.
[
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	The original fireplaces within the property have been removed/blocked and we presume adequately vented. A brick hearth remains in place within the bedroom and there is an imitation fireplace within the lounge.

Internal decorations	Visually inspected.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply of electricity.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. There is a gas meter within the property although there are no gas appliances.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Mains supply of water. There is a stainless steel sink unit within the kitchen and the plumbing below this is of PVC and copper design. The fittings within the shower room are modern and it is understood the shower cubicle is recently installed. There is an insulated cold water tank within the roof space and no close inspection of this was possible.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Space heating is by means of an electric panel system. Domestic hot water is provided by an electrical immersion heater. There is an insulated hot water cylinder boxed-in within the bedroom.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Presumed to be connected to the main public sewer.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	Hard wired smoke alarms are provided within the property.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.


The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

It is outwith the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.

No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or neighbouring properties.

Insulation has been laid over the roof joists and accordingly a head and shoulders inspection of the roof space was possible only.

Sectional Diagram showing elements of a typical house

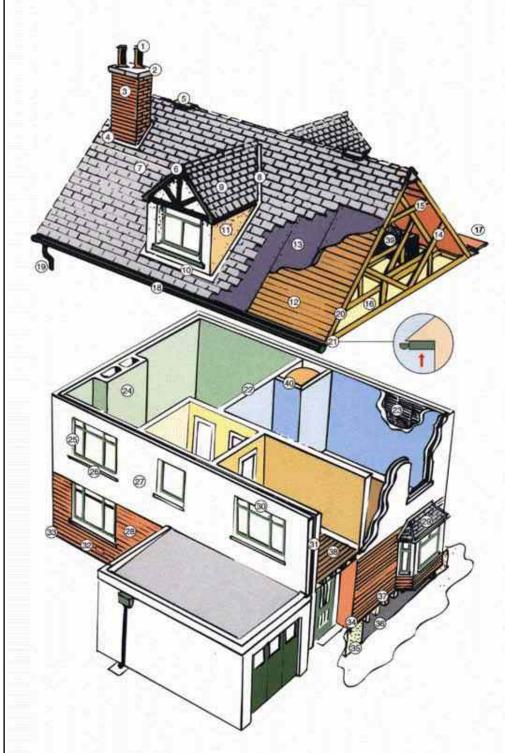

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1 Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4 Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9) Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 0) Verge boards /skews
- (21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- Latin / plaster
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- (27) Rendering
- 28) Brickwork / pointing
- 29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 9) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement		
Repair category	1	
Notes	There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.	

Dampness, rot and infestation	
Repair category	2
Notes	New timbers were noted within the roof space and this may be the result of previous timber specialist repair works. Any reports and guarantees in this regard should be obtained, studied and authenticated prior to purchase. Significant staining is noted within the roof space and there is also evidence of water penetration within the stairwell although this was dry at the time of our inspection. It would be prudent to instruct a timber and damp specialist firm prior to purchase to carry out an inspection of the property and mutual areas.

Chimney stacks	
Repair category	1
Notes	No evidence of significant defect is apparent.

Roofing including roof space	
Repair category	2
Notes	From ground level the roof covering appears to be in fair condition although, due to the age of the property, ongoing maintenance and repair should be anticipated. Typical weathering is apparent and, as stated, staining was noted within the roof space.

Rainwater fittings	
Repair category	2
Notes	The gutters are choked and require to be cleared.

Main walls	
Repair category	1
Notes	No evidence of significant defect is apparent although typical weathering has occurred.

Windows, external doors and joinery	
Repair category	2
Notes	These are of an older style double glazed design and are affected by typical wear and tear. One or two windows are slightly ill-fitting and the external safety bars are affected by some corrosion. Opening mechanisms, etc., will require regular maintenance.

External decorations	
Repair category	1
Notes	PVC windows require no decoration.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	2
Notes	Typical plaster cracking has occurred within this area and there is evidence of staining around the second and third floor close windows. This was dry at the time of our inspection. The windows serving the stairwell require attention.

Garages and permanent outbuildings	
Repair category	2
Notes	The cellars within the rear garden are in need of extensive repairs.

Outside areas and boundaries	
Repair category	1
Notes	Loose coping stones and some cracking was noted to the boundary walls to the rear.

Ceilings	
Repair category	1
Notes	No evidence of significant defect is apparent. Timber lath and plaster surfaces have a limited life.

Internal walls	
Repair category	1
Notes	The internal walls are largely covered with decorative finishes. During routine redecoration some plaster filling may be necessary.

Floors including sub-floors	
Repair category	1
Notes	There is a slight run in the kitchen floor. This is due to movement which on the basis of a single inspection appears to be longstanding and non-progressive.

Internal joinery and kitchen fittings	
Repair category	1
Notes	The internal joinery is generally in keeping with the age and type of property and appeared in fair condition consistent with age. The kitchen fittings are generally in adequate condition for their age and type. One or two doors are ill-fitting. Typical wear and tear has occurred.

Chimney breasts and fireplaces	
Repair category	1
Notes	All original fireplaces have been removed/blocked and we assume adequately vented.

Internal decorations	
Repair category	1
Notes	The property is generally in fresh decoration throughout.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	It appears that a degree of upgrading has been carried out and there is a modern consumer unit. One or two areas of wiring do appear to be on semi-modern/older lines. It is understood that an IEE Certificate is available and this should be obtained. The Institution of Engineering and Technology recommends that inspections and
	testing are undertaken at least every ten years and on a change of ownership. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	There are no gas appliances within the property.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	The plumbing and fittings appear of copper/PVC piping where seen and appeared in serviceable condition but was not tested. The sanitary fittings are of modern style and type.

Heating and hot water	
Repair category	1
Notes	The system was not checked or tested.

Drainage	
Repair category	1
Notes	The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	2
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Third Floor	
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X	
3. Is there a lift to the main entrance door of the property?	Yes No X	
4. Are all door openings greater than 750mm?	Yes No X	
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No	
6. Is there a toilet on the same level as a bedroom?	Yes X No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No	
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that when repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

A check should be made to ascertain if any timber specialist repair works have been carried out within the property in the past and all reports and guarantees should be obtained, studied and authenticated prior to purchase.

Property market activity has been impacted due to the current response to COVID-19. This has resulted in an unprecedented set of circumstances on which to make a valuation judgement. The advice is therefore reported on the basis of 'material valuation uncertainty' as per the RICS Red Book Global definition. Consequently, less certainty can be attached to the valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

Estimated reinstatement cost for insurance purposes

We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £120.000.

Valuation and market comments

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £70,000 (SEVENTY THOUSAND POUNDS).

Signed	Security Print Code [549034 = 8703] Electronically signed
Report author	Graham Tonner
Company name	Graham & Sibbald

Address	1 Greenmarket, Dundee, DD1 4QB
Date of report	3rd August 2020

GRAHAM + SIBBALD

Property Address	
Address Seller's Name Date of Inspection	15H Forest Park Road, Dundee, DD1 5NZ Williamson Trust 27th July 2020
Property Details	
Property Type	House Bungalow Purpose built maisonette Converted maisonette X Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block □ X Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No silitary, police?
Flats/Maisonettes only Approximate Year of	No. of units in block 8
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 1 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 1 WC(s) 0 Other (Specify in General remarks)
	cluding garages and outbuildings) 42 m² (Internal) m² (External) (greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site? Permanent outbuilding	☐ Double garage ☐ Parking space ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / garage space / parking space ☐ Yes ☐ X No garage / gar

Construction							
Walls	Brick	X Stone	Concrete	Timber frame	Othe	r (specify in Ger	eral Remarks)
Roof	Tile	X Slate	Asphalt	Felt	Othe	r (specify in Ger	eral Remarks)
Special Risks							
Has the property s	suffered struc	ctural moveme	ent?			X Yes	No
If Yes, is this rece	nt or progres	ssive?				Yes	X No
Is there evidence, immediate vicinity	•	eason to antic	ipate subsidence	, heave, landslip o	or flood in the	e Yes	X No
If Yes to any of the	e above, pro	vide details in	General Remark	KS.			
Service Connec	ctions						
Based on visual ir of the supply in G			ices appear to be	e non-mains, pleas	se comment	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	Yes	Partial	X None				
Brief description of	of Central He	ating:					
Site							
Apparent legal iss	ues to be ve	rified by the c	onvevancer Ple	ase provide a brie	f description	in General R	emarks
Rights of way	X Shared dri	-	_	amenities on separate		red service conr	
Ill-defined boundar			tural land included w			er (specify in Ge	
Location							
Residential suburb	X Re	esidential within to	own / city Mixe	ed residential / comme	rcial Mai	nly commercial	
Commuter village	Re	emote village	Isola	ated rural property	Oth	er (specify in Ge	neral Remarks)
Planning Issues	5						
Has the property b	been extende	ed / converted	/ altered?	Yes X No			
If Yes provide deta	ails in Gener	al Remarks.					
Roads							
X Made up road	Unmade roa	ad Partly	completed new road	Pedestrian a	access only	Adopted	Unadopted

General Remarks

The subjects comprise a purpose-built, self-contained third floor flat, part of a four storey mid- terraced tenement building located to the west of Dundee City Centre. Adequate facilities can be found within easy reach. Externally, we noted no evidence of serious defect to the main fabric although general maintenance repairs are required and ongoing maintenance should be anticipated. Internally, fittings and fixtures are on serviceable lines and decoration is to a fair standard throughout. While defects were noted these are commonly found in a property of this type and as far as possible have been reflected in the valuation.

Due to fitted floor coverings, no detailed inspection was possible of the floor timbers.

There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.

It appears that timber specialist repair works have been carried out within the property in the past and all reports and guarantees should be obtained, studied and authenticated prior to purchase. Excessive staining was noted to the sarking timbers within the roof space and staining was noted within the stairwell. It is recommend that, as a precautionary measure, a timber and damp specialist firm is instructed prior to purchase to carry out an inspection of the property and mutual areas.

Essential Repairs			
None.			
Estimated cost of essential repairs £	Retention recommended? Yes	No	Amount £

Comment on Mortgagea	bility		
	e security for normal mortgage purposes, although any purchaser should cts meet with their lender's criteria.	satisfy	
Valuations			
Market value in present cor	ndition	£ 70,000	
Market value on completion of essential repairs			
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)		£ 120,000	
Is a reinspection necessary?			
Buy To Let Cases			
What is the reasonable rangementh Short Assured Tenal	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£ N/A	
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No	
Declaration			
Signed	Security Print Code [549034 = 8703] Electronically signed by:-		
Surveyor's name	Graham Tonner		
Professional qualifications	MRICS		
Company name	Graham & Sibbald		
Address	1 Greenmarket, Dundee, DD1 4QB		
Telephone	01382 200064		

Fax

Report date

01382 229773

3rd August 2020