

# Home report



**[thorntons-property.co.uk](https://www.thorntons-property.co.uk)**

Thorntons is a trading name of Thorntons Law LLP

# property questionnaire

<b>Property address</b>	<b>68 Camphill Road, Broughty Ferry, Dundee, DD5 2LX</b>
-------------------------	--

<b>Seller(s)</b>	<b>R.L &amp; Mrs M McHoul</b>
------------------	-------------------------------

<b>Completion date of property questionnaire</b>	<b>11/08/2020</b>
--	-------------------

**GRAHAM + SIBBALD**

# property questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

<b>1.</b>	<b>Length of ownership</b>	
	How long have you owned the property? <b>31 years &amp; 10 months</b>	
<b>2.</b>	<b>Council tax</b>	
	Which Council Tax band is your property in? <b>G</b>	
<b>3.</b>	<b>Parking</b>	
	What are the arrangements for parking at your property? (Please tick all that apply) <ul style="list-style-type: none"><li>• Garage</li><li>• Allocated parking space</li><li>• Driveway <b>Yes</b></li><li>• Shared parking</li><li>• On street <b>Yes</b></li><li>• Resident permit</li><li>• Metered parking</li><li>• Other (please specify):</li></ul>	
<b>4.</b>	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<b>Yes</b>

# property questionnaire

<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<b>No</b>
<b>6.</b>	<b>Alterations/additions/extensions</b>	
<b>a.</b>	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	<b>No</b>
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	
<b>b.</b>	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<b>Yes</b>
	(i) Were the replacements the same shape and type as the ones you replaced?	<b>Yes</b>
	(ii) Did this work involve any changes to the window or door openings?	<b>No</b>
	<p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p> <p><b>Bathroom window replaced with double glazed unit</b></p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

# property questionnaire

<b>7.</b>	<b>Central heating</b>	
<b>a.</b>	<p>Is there a central heating system in your property?</p> <p>(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there?</p> <p>(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p><b>gas fired</b></p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<b>Yes</b>
	(i) When was your central heating system or partial central heating system installed? <b>Before we purchased the property</b>	
	<p>(ii) Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p>	<b>No</b>
	<p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p> <p><b>September 2018</b></p>	
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<b>No</b>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<b>No</b>
<b>b.</b>	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<b>No</b>

# property questionnaire

<b>10.</b>	<b>Services</b>																									
<b>a.</b> Please tick which services are connected to your property and give details of the supplier:																										
	<table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td><b>Yes</b></td> <td><b>EDF</b></td> </tr> <tr> <td>Water mains or private water supply</td> <td><b>Yes</b></td> <td><b>Scottish Water</b></td> </tr> <tr> <td>Electricity</td> <td><b>Yes</b></td> <td><b>EDF</b></td> </tr> <tr> <td>Mains drainage</td> <td><b>Yes</b></td> <td><b>Scottish Water</b></td> </tr> <tr> <td>Telephone</td> <td><b>Yes</b></td> <td><b>Virgin Media</b></td> </tr> <tr> <td>Cable TV or satellite</td> <td></td> <td></td> </tr> <tr> <td>Broadband</td> <td><b>Yes</b></td> <td><b>Virgin Media</b></td> </tr> </tbody> </table>	Services	Connected	Supplier	Gas or liquid petroleum gas	<b>Yes</b>	<b>EDF</b>	Water mains or private water supply	<b>Yes</b>	<b>Scottish Water</b>	Electricity	<b>Yes</b>	<b>EDF</b>	Mains drainage	<b>Yes</b>	<b>Scottish Water</b>	Telephone	<b>Yes</b>	<b>Virgin Media</b>	Cable TV or satellite			Broadband	<b>Yes</b>	<b>Virgin Media</b>	
Services	Connected	Supplier																								
Gas or liquid petroleum gas	<b>Yes</b>	<b>EDF</b>																								
Water mains or private water supply	<b>Yes</b>	<b>Scottish Water</b>																								
Electricity	<b>Yes</b>	<b>EDF</b>																								
Mains drainage	<b>Yes</b>	<b>Scottish Water</b>																								
Telephone	<b>Yes</b>	<b>Virgin Media</b>																								
Cable TV or satellite																										
Broadband	<b>Yes</b>	<b>Virgin Media</b>																								
<b>b.</b>	Is there a septic tank system at your property? <u>If you have answered yes</u> , please answer the two questions below:	<b>No</b>																								
	(iv) Do you have appropriate consents for the discharge from your septic tank?																									
	(v) Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u> , please give details of the company with which you have a maintenance contract:																									

# property questionnaire

<b>11.</b>	<b>Responsibilities for shared or common areas</b>	
<b>a.</b>	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes</u>, please give details:</p>	<b>No</b>
<b>b.</b>	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p> <p><b>Joint responsibility with neighbour at 66 Camphill Road for roof and drainage maintenance</b></p>	<b>Yes</b>
<b>c.</b>	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<b>Yes</b>
<b>d.</b>	<p>Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p> <p><b>for the maintenance of the property of 68 Camphill Road</b></p>	<b>Yes</b>
<b>e.</b>	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p> <p><b>Only for the maintenance of the property of 66 Camphill Road</b></p>	<b>Yes</b>
<b>f.</b>	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes</u>, please give details:</p>	<b>No</b>
<b>12.</b>	<b>Charges associated with your property</b>	
<b>a.</b>	<p>Is there a factor or property manager for your property?</p>	<b>No</b>

# property questionnaire

	<p>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</p>	
--	---	--



# property questionnaire

<b>b.</b>	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<b>No</b>
<b>c.</b>	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<b>13.</b>	<b>Specialist works</b>	
<b>a.</b>	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.</p> <p><b>Small area of rot to rafter ends above study window and to window surrounds. Repairs carried out just after purchase of property 30 years ago.</b></p>	<b>Yes</b>
<b>b.</b>	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p><u>If you have answered yes</u>, please give details:</p> <p><b>As noted above - guarantee expired</b></p>	<b>Yes</b>
<b>c.</b>	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work?</p> <p><u>If you have answered yes</u>, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<b>No</b>

# property questionnaire

<b>14.</b>	<b>Guarantees</b>	
<b>a.</b>	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<b>No</b>
(ii)	Roofing	<b>No</b>
(iii)	Central heating	<b>No</b>
(iv)	National House Building Council (NHBC)	<b>No</b>
(v)	Damp course	<b>No</b>
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<b>No</b>
<b>b.</b>	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
<b>c.</b>	Are there any outstanding claims under any of the guarantees listed above?  If you have answered yes, please give details:	<b>No</b>
<b>15.</b>	<b>Boundaries</b>	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?  If you have answered yes, please give details:	<b>No</b>

# property questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
In the past three years have you ever received a notice:		
<b>a.</b>	advising that the owner of a neighbouring property has made a planning application?	<b>No</b>
<b>b.</b>	that affects your property in some other way?	<b>No</b>
<b>c.</b>	that requires you to do any maintenance, repairs or improvements to your property?	<b>No</b>
<u>If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u>		

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**I ACCEPT** ☒

**Name:** **Ronald Lindsey McHoul**

**Date:** **11/08/2020**

# Energy Performance Certificate (EPC)

Dwellings

# Scotland

68 CAMPHILL ROAD, BROUGHTY FERRY, DUNDEE, DD5 2LX

**Dwelling type:** Top-floor flat  
**Date of assessment:** 04 August 2020  
**Date of certificate:** 05 August 2020  
**Total floor area:** 236 m<sup>2</sup>  
**Primary Energy Indicator:** 311 kWh/m<sup>2</sup>/year

**Reference number:** 0180-2764-6280-2600-4531  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,719	See your recommendations report for more information
Over 3 years you could save*	£3,948	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Current	Potential
56	78


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (56)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO<sub>2</sub> emissions

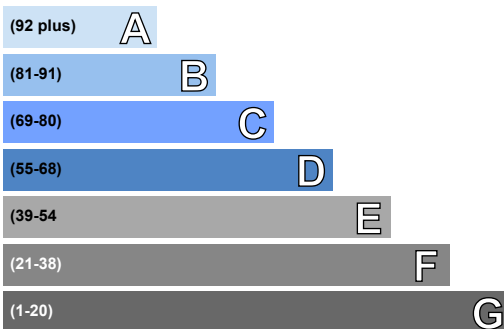

Current	Potential
45	74

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (45)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£2337.00
2 Low energy lighting	£60	£165.00
3 Heating controls (room thermostat)	£350 - £450	£360.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 350 mm loft insulation	★★★★★	★★★★★
Floor	(another dwelling below)	—	—
Windows	Partial double glazing	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 50% of fixed outlets	★★★★☆	★★★★☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 55 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 13 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 7.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.









## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,531 over 3 years	£3,006 over 3 years	
Hot water	£582 over 3 years	£360 over 3 years	
Lighting	£606 over 3 years	£405 over 3 years	
<b>Totals</b>	<b>£7,719</b>	<b>£3,771</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£779		
2 Low energy lighting for all fixed outlets	£60	£55		
3 Upgrade heating controls	£350 - £450	£120		
4 Replace boiler with new condensing boiler	£2,200 - £3,000	£362		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Micro CHP

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

### 2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

### 4 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to [www.energysavingtrust.org.uk/scotland/rhi](http://www.energysavingtrust.org.uk/scotland/rhi).

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	31,758	N/A	N/A	(12,042)
Water heating (kWh per year)	2,819			

## Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Graeme Gilchrist
Assessor membership number:	EES/022325
Company name/trading name:	Graham & Sibbald
Address:	1 Greenmarket Dundee DD1 4QB
Phone number:	01382 200064
Email address:	<a href="mailto:dundee@g-s.co.uk">dundee@g-s.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).



### **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



# Single Survey

survey report on:

Property address	68 Camphill Road Broughty Ferry Dundee DD5 2LX
Customer	Mr R McHoul & Mrs M McHoul
Customer address	c/o Thorntons Whitehall House 33 Yeaman Shore Dundee DD1 4BJ
Prepared by	Graham & Sibbald
Date of inspection	4th August 2020

**GRAHAM + SIBBALD**

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.



## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The subjects comprise a split level first floor divided villa with ground floor, main door, access. The subjects form part of a two storey former manse building divided into two residential units.
<b>Accommodation</b>	GROUND FLOOR: Entrance Hallway, store, staircase leading to:  SPLIT FIRST FLOOR: Landing, Stairway, Hallway, Lounge, Dining Room, Bedroom with Dresser off, One Further Bedroom, Study, Kitchen, Bathroom with Shower and WC, Secondary stair leading to Hallway, Two Bedrooms, Cloakroom with WC.
<b>Gross internal floor area (m²)</b>	236.
<b>Neighbourhood and location</b>	The subjects are situated within a long established private residential area within central Broughty Ferry. The surrounding properties are of a similar residential nature and all amenities can be found within easy reach.
<b>Age</b>	Originally erected circa 1860 and divided we understand circa 1950s.
<b>Weather</b>	Wet
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  The chimney stacks are of traditional solid stone construction and where viewed are served with metal flashings.

<b>Roofing including roof space</b>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof is of multi pitched timber design externally laid in slates incorporating metal ridging and flat/shallow pitched sections overlaid in what appears to be lead. The roof structure incorporates dormer projections which are slate and timber clad.</p> <p>Access to the roof space is possible via a hatch within the secondary hallway. Due to insulation levels and the nature of the roof pitch only a very restricted head and shoulders view was possible of the roof space directly surrounding the hatch.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>The rainwater goods are of cast iron and pvc design. The roof structure incorporates lead valley gutter sections.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The main walls are of solid stone construction, internally strapped and lined.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>The windows comprise a mixture of timber casement sash and case single glazed and timber casement double glazed design. There is also a metal casement single glazed shutter style unit within the wc and there is a Perspex skylight within the secondary hallway.</p> <p>Access to the property is via a timber/glazed entry door.</p>

# Single Survey

<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>Elements of the external fabric have a painted/preservative finish.</p>
<b>Conservatories / porches</b>	Not applicable.
<b>Communal areas</b>	Not applicable.
<b>Garages and permanent outbuildings</b>	<p><b>Visually inspected.</b></p> <p>There is an external store of stone and brick construction. This has a flat timber roof overlaid in mineral felt. There is also a timber garden shed.</p>
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>The property has private areas of garden ground to the front, side and rear and off street parking is provided. The site is partially open plan although is predominantly enclosed with traditional stone walls. There is an additional area of garden ground to the eastmost side of the walled site.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>The ceilings appear to be predominantly of timber lath and plaster throughout.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls appear to be of timber lath and plaster and brick plastered on the hard.</p>
<b>Floors including sub floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>The flooring within is of suspended timber. The floors were fully covered and no access was gained to any sub floor chambers.</p>

# Single Survey

Internal joinery and kitchen fittings	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>The internal doors are of timber panel design.</p> <p>The kitchen incorporates base and wall units.</p>
Chimney breasts and fireplaces	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>There is a gas fire within the lounge. No tests were carried out. Any other fire openings appear to have been removed/blocked over and we presume adequately vented.</p>
Internal decorations	<p><b>Visually inspected.</b></p> <p>The internal surfaces have a papered/painted finish and there are areas clad in tiling.</p>
Cellars	<p>Not applicable.</p>
Electricity	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply. The meter is located within the entrance hallway and there is a distribution board within the first floor landing.</p>
Gas	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply.</p>
Water, plumbing, bathroom fittings	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply. There is a sink unit in the kitchen and the plumbing where viewed is of pvc and copper design.</p> <p>The bathroom incorporates a wc, wash hand basin, shower cubicle with mixer shower fitted and separate bath unit. There is also a separate wc within the secondary hallway.</p>

# Single Survey

<p><b>Heating and hot water</b></p>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Space heating is by means of a gas fired system. There is an Ideal Mexico floor standing non- condensing regular boiler located within the kitchen cupboard. The hot water cylinder for the system is located within the roof space. Due to its position no close inspection was possible. The system feeds wall mounted radiators.</p>
<p><b>Drainage</b></p>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Mains sewer connection.</p>
<p><b>Fire, smoke and burglar alarms</b></p>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>The presence or otherwise of burglar alarms has not been commented on for security reasons.</p>
<p><b>Any additional limits to inspection</b></p>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>It is outwith the scope of this inspection to determine whether or not asbestos based products are present within the property. Asbestos was widely used in the building industry until around 1999, when it became a banned substance. If you have any concerns you should engage the services of a qualified asbestos surveyor.</p> <p>No inspection for Japanese Knotweed was carried out and unless otherwise stated for the purpose of this report, it is assumed that there is no Japanese Knotweed within the boundaries of the property or neighbouring properties.</p> <p>Our inspection of the property was restricted due to contents and furnishings.</p> <p>Only a very restricted view was possible of the roof timbers and only a restricted view was possible of the roof coverings due to the</p>

## Single Survey

	detailed nature of the roof pitch and the location of boundaries/neighbouring properties.
--	---



## Sectional Diagram showing elements of a typical house




Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey


## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	There is evidence of past structural movement having affected the property observed in the form of internal cracking, a run in the flooring and distorted internal joinery. On the basis of a single superficial inspection this appears to be longstanding and non progressive.

 Dampness, rot and infestation	
Repair category	1
Notes	<p>Damp meter testings were carried out where considered appropriate within the property and no elevated moisture levels were detected.</p> <p>We understand that past timber specialist repair works have been carried out in the building in the past, circa 30 years ago, and a copy of any available documentation in this regard should be obtained.</p> <p>There are isolated areas of damp staining to ceilings although these were dry at the time of our inspection. Monitoring will be required.</p>

 Chimney stacks	
Repair category	2
Notes	We understand that recent lead replacement works have been carried out to the flashing details. Open mortar joints were noted to the stacks and in view of their age they will require continued maintenance.

 Roofing including roof space	
Repair category	2
Notes	The roof covering was noted to be in fair condition consistent with its age and material type. We understand that recent lead replacement works have been carried out. Within the roof space, areas of staining were noted to roof timbers



# Single Survey

	<p>although these were dry when tested at the time of our inspection. It should be appreciated that only a very restricted view was possible of the roof timbers and there may be concealed defects within those areas not available for inspection.</p> <p>The roof covering is now of an age where ongoing repair and regular maintenance will be required and it would be prudent to seek the advice of a roofing contractor to comment on its current condition and expected lifespan.</p>
--	--



## Rainwater fittings

Repair category	1
Notes	A large proportion of the guttering serving the building has been replaced with modern pvc. There does however remain traditional cast iron sections of which general weathering was noted. There is a leak to a section of guttering at the rear of the side outshoot. We understand that this is to be attended to prior to sale. There is a basic taping join to the downpipe serving this gutter also.



## Main walls

Repair category	1
Notes	The main outer walls generally appeared in fair condition consistent with the age and construction type of the building.



## Windows, external doors and joinery

Repair category	2
Notes	<p>The windows are of mixed age although were found to function adequately where tested at random. Weathering was noted to a number of units. It should be appreciated that the windows are of an older style and will require continued maintenance to ensure they are kept in satisfactory condition.</p> <p>Recent re-sealing works have been carried out to a number of units.</p>



## External decorations

Repair category	2
Notes	Weathering and isolated decay was noted to fascia/soffit boards.



## Conservatories/porches

Repair category	-
Notes	Not applicable.



## Communal areas

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Garages and permanent outbuildings

<b>Repair category</b>	2
<b>Notes</b>	The store appears in adequate condition for its age and construction type. There is dampness to roof timbers and wood boring insect infestation also. There is decay to external timbers. General repairs are required.



## Outside areas and boundaries

<b>Repair category</b>	2
<b>Notes</b>	<p>The outside areas were found to be well maintained at the time of our inspection. Open joints and cracking were noted to the boundary walls and some sections were noted to be slightly leaning. In view of their age and type they will require continued maintenance/monitoring.</p> <p>There is an additional area of garden ground to the eastmost side of the walled site. We however understand that this is to be split from the Title prior to sale. The garden ground under this report is that which is directly to the front, side and rear. All details in this regard should be confirmed prior to sale.</p>



## Ceilings

<b>Repair category</b>	2
<b>Notes</b>	<p>The ceilings generally appeared in fair condition for their age although there are areas of cracking and uneven surfaces suggesting that the plaster beneath may have lost key. There is a bow and cracking to the moulding within the main bedroom. It would be prudent to have this investigated further.</p> <p>There is condensation staining to the utility room ceiling.</p>



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	No significant defects apparent. There were minor cracks/blemishes.



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	No significant defect apparent. There is a slight run in the flooring as a result of past movement.



## Internal joinery and kitchen fittings

<b>Repair category</b>	1
<b>Notes</b>	<p>The internal joinery is mainly traditional in style. There are distorted door surrounds as a result of past movement.</p> <p>No significant defect was noted to the kitchen fittings.</p>



## Chimney breasts and fireplaces

<b>Repair category</b>	1
<b>Notes</b>	<p>No tests carried out.</p> <p>All original fireplaces have been removed/blocked and we assume adequately vented.</p>



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	The property is generally well presented.



## Cellars

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Electricity

<b>Repair category</b>	2
<b>Notes</b>	The electrical system is of mixed age and incorporates older style elements which would not comply with current building regulations. As in all cases, the system should be checked prior to purchase by an NICEIC/SELECT registered electrical contractor.



## Gas

<b>Repair category</b>	1
<b>Notes</b>	In the interests of safety, all gas appliances should be checked by a Gas Safe registered engineer.

# Single Survey



## Water, plumbing and bathroom fittings

Repair category	1
Notes	<p>The plumbing and fittings appear of copper/pvc piping where seen and appeared in serviceable condition but was not tested.</p> <p>The sanitary fittings are of a modern style and appear in serviceable condition from our visual inspection.</p>



## Heating and hot water

Repair category	2
Notes	<p>The hot water cylinder we understand has recently been replaced. The boiler is however dated and upgrading of this should be anticipated. We understand that an annual service has been carried out of the boiler and all available documentation should be obtained in this regard. Any outstanding recommendations therein should be implemented.</p>



## Drainage

Repair category	1
Notes	<p>The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.</p>

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	2
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Split First Level
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that when repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

Property market activity has been impacted due to the current response to COVID-19. This has resulted in an unprecedented set of circumstances on which to make a valuation judgement. The advice is therefore reported on the basis of 'material valuation uncertainty' as per the RICS Red Book Global definition. Consequently, less certainty can be attached to the valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

There is an additional area of garden ground to the eastmost side of the walled site. We however understand that this is to be split from the title prior to sale. The garden ground under this report is that which is directly to the front, side and rear. All details in this regard should be confirmed prior to sale.

It is assumed that there is an equitable split for common repairing liability.

The property is located within a conservation area.

We are unaware of any significant recent alterations having been carried out within the property.

### Estimated reinstatement cost for insurance purposes

We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £780,000.

### Valuation and market comments

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £340,000 (THREE HUNDRED AND FORTY THOUSAND POUNDS).

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

**Signed**

Security Print Code [519612 = 7013 ]  
Electronically signed

# Single Survey

<b>Report author</b>	Graeme Gilchrist
<b>Company name</b>	Graham & Sibbald
<b>Address</b>	Endeavour House, 1 Greenmarket, Dundee, DD1 4QB
<b>Date of report</b>	13th August 2020



# Mortgage Valuation Report

**GRAHAM + SIBBALD**

## Property Address

Address 68 Camphill Road, Broughty Ferry, Dundee, DD5 2LX  
Seller's Name Mr R McHoul & Mrs M McHoul  
Date of Inspection 4th August 2020

## Property Details

Property Type ☐ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette  
☐ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use  
☒ Other (specify in General Remarks)

Property Style ☐ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace  
☐ Back to back ☐ High rise block ☐ Low rise block ☒ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided? ☐ Yes ☐ No  
No. of units in block

Approximate Year of Construction

## Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

## Garage / Parking / Outbuildings

☐ Single garage ☐ Double garage ☒ Parking space ☐ No garage / garage space / parking space  
Available on site? ☒ Yes ☐ No

Permanent outbuildings:

External store.

# Mortgage Valuation Report

## Construction

Walls ☐ Brick ☒ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)  
Roof ☐ Tile ☒ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement? ☒ Yes ☐ No

If Yes, is this recent or progressive? ☐ Yes ☒ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None  
Electricity ☒ Mains ☐ Private ☐ None Gas ☒ Mains ☐ Private ☐ None  
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Gas fired.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☐ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections  
☐ Ill-defined boundaries ☐ Agricultural land included with property ☒ Other (specify in General Remarks)

## Location

☐ Residential suburb ☒ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial  
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered? ☐ Yes ☒ No

If Yes provide details in General Remarks.

## Roads

☒ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☐ Adopted ☐ Unadopted

# Mortgage Valuation Report

## General Remarks

The subjects comprise a split level divided villa forming part of a two storey former manse building containing two residential units. The property is located within a long-established private residential area in easy reach of all amenities. At the time of inspection the property was found to be well presented and in fair condition structurally for its age and construction type. Defects noted are common in properties of this type and as far as possible have been reflected in our valuation.

There is evidence of past structural movement having affected the property observed in the form of internal cracking, a run in the flooring and distorted internal joinery. On the basis of a single superficial inspection this appears to be longstanding and non progressive.

The electrical heating systems incorporate older style elements and, as in all cases, should be checked prior to purchase.

There is an additional area of garden ground to the eastmost side of the walled site. We however understand that this is to be split from the title prior to sale. The garden ground under this report is that which is directly to the front, side and rear. All detailed in this regard should be confirmed prior to sale.

It is assumed that there is an equitable split for common repairing liability.

The property is located within a conservation area.

## Essential Repairs

None

Estimated cost of essential repairs £  Retention recommended? ☐ Yes ☐ No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

In our opinion the subjects form suitable security for normal mortgage purposes.

## Valuations

Market value in present condition £ 340,000  
Market value on completion of essential repairs £  
Insurance reinstatement value £ 780,000  
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)  
Is a reinspection necessary? ☐ Yes ☐ No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £ N/A  
Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

## Declaration

Signed Security Print Code [519612 = 7013 ]  
Electronically signed by:-  
Surveyor's name Graeme Gilchrist  
Professional qualifications MRICS  
Company name Graham & Sibbald  
Address Endeavour House, 1 Greenmarket, Dundee, DD1 4QB  
Telephone 01382 200064  
Fax 01382 229773  
Report date 13th August 2020