

# Home report



thorntons-property.co.uk

Thorntons is a trading name of Thorntons Law LLP

# **HOME REPORT**

42 SPECKLED WOOD COURT DUNDEE DD4 0LY



# ENERGY PERFORMANCE CERTIFICATE



#### **Energy Performance Certificate (EPC)**

**Dwellings** 

### **Scotland**

#### 42 SPECKLED WOOD COURT, DUNDEE, DD4 0LY

Dwelling type:Ground-floor flatDate of assessment:05 August 2020Date of certificate:10 August 2020

Total floor area: 45 m<sup>2</sup>

Primary Energy Indicator: 456 kWh/m²/year

**Reference number:** 0854-1005-5208-8490-6204 **Type of assessment:** RdSAP, existing dwelling

**Approved Organisation:** Elmhurst


Main heating and fuel: Electric storage heaters

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,238	See your recommendations
Over 3 years you could save*	£801	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

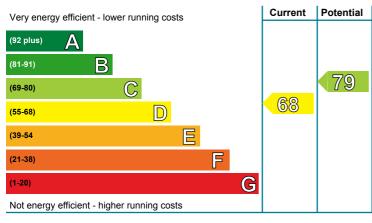


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (68)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

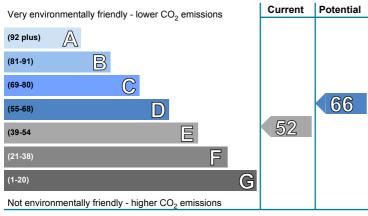

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (52)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (solid floor)	£4,000 - £6,000	£426.00
2 Add additional 80 mm jacket to hot water cylinder	£15 - £30	£57.00
3 High heat retention storage heaters	£800 - £1,200	£321.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, with external insulation	****	****
Roof	(another dwelling above)	_	_
Floor	Solid, no insulation (assumed)	_	_
Windows	Fully double glazed	<b>★★★☆☆</b>	<b>★★★☆☆</b>
Main heating	Electric storage heaters	<b>★★★☆☆</b>	***
Main heating controls	Manual charge control	***	***
Secondary heating	Portable electric heaters (assumed)	_	_
Hot water	Electric immersion, off-peak	***	***
Lighting	Low energy lighting in all fixed outlets	****	****

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 77 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.0 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

		Current energy costs	Potential energy costs	Potential future savings
Heating		£1,449 over 3 years	£828 over 3 years	
Hot water		£651 over 3 years	£471 over 3 years	You could
Lighting		£138 over 3 years	£138 over 3 years	save £801
	Totals	£2,238	£1,437	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Da	samman dad massuras	Indicative cost	Typical saving	Rating after improvement	
Re	ecommended measures	Indicative cost	per year	Energy	Environment
1	Floor insulation (solid floor)	£4,000 - £6,000	£142	C 74	D 61
2	Add additional 80 mm jacket to hot water cylinder	£15 - £30	£19	C 75	D 62
3	High heat retention storage heaters and dual immersion cylinder	£800 - £1,200	£107	C 79	D 66

#### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

#### **Choosing** the right improvement package





#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

#### 2 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

#### 3 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

#### Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,524	N/A	N/A	N/A
Water heating (kWh per year)	1,937			

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Mr. Robert Fraser Assessor's name: Assessor membership number: EES/018605

D M Hall Chartered Surveyors LLP Company name/trading name:

Address: 17 Corstorphine Road

Edinburgh EH12 6DD

Phone number: 0131 477 6006

enquiries@dmhall.co.uk Email address: Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



# SINGLE SURVEY



#### survey report on:

Property address	42 SPECKLED WOOD COURT DUNDEE DD4 0LY		
Customer	ALISON HOWITT		
Customer address	42 SPECKLED WOOD COURT DUNDEE DD4 0LY		
Prepared by	DM HALL LLP		
Date of inspection	5th August 2020		



#### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### 1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### 1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

#### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property comprises a self contained purpose built ground floor flat in a five storey block of sixteen. The property was originally owned by the Local Authority.
Accommodation	The accommodation within comprises on ground floor: Entrance Hall, Lounge, Bedroom, Kitchen and Shower Room with WC.
Gross internal floor area (m²)	45 square metres or thereby.
Neighbourhood and location	The property is located within an established residential area within the Whitfield district of Dundee where surrounding properties are of similar class in nature. There are good amenities available nearby and the property is suitable to the district.
Age	Circa 1970
Weather	Overcast
Chimney stacks	There are no chimney heads serving the property.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	The roof is pitched and tiled and finished with a tiled ridge. The structure has been constructed over what was originally a flat reinforced concrete roof structure.
	There is no roof void access.

B		
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.	
	The rainwater pipes are in PVC and taken below ground level.	
Main walls	Visually inspected with the aid of binoculars where appropriate.	
	Foundations and concealed parts were not exposed or inspected.	
	The subjects are of non traditional construction having been elected by Crudens Skarne Industrial Housing System.	
	This comprises a precast reinforced concrete frame infilled with brick/block. During the refurbishment process this was insulated and roughcast externally.	
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.	
	Random windows were opened and closed where possible.	
	Doors and windows were not forced open.	
	The windows are of timber casement design with double glazed panels.	
	The entrance door to the property is of timber construction.	
External decorations	Visually inspected.	
	The external timbers are painted.	
Conservatories / porches	None.	
Communal areas	Circulation areas visually inspected.	
	There is a communal stairwell to the side of the property. This serves the upper flats only.	
Garages and permanent outbuildings	Visually inspected.	
	There is no space on site for the erection of a garage and no off street parking available.	
Outside areas and boundaries	Visually inspected.	
	The property occupies a site within a small area of forecourt that is exclusively used by the property. The boundaries are in metal and	
	masonry construction.	

Ceilings are of reinforced concrete with an artex finish.		
Internal walls  Visually inspected from floor level.  Using a moisture meter, walls were randomly tested for dampness where considered appropriate.  Internal walls are party of concrete and partly dry lined.  Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.  Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subje to a minimum clearance of 1 m between the underside of floo joists and the solum as determined from the access hatch.  Floors throughout are of solid construction with a floated timber finish. At the time of inspection the property was vacant but all flowere covered.  Internal joinery and kitchen fittings  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected withour removing fittings. No tests whatsoever were carried out to it system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	Ceilings	Visually inspected from floor level.
Using a moisture meter, walls were randomly tested for dampness where considered appropriate.  Internal walls are party of concrete and partly dry lined.  Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.  Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subjet to a minimum clearance of 1m between the underside of floot joists and the solum as determined from the access hatch.  Floors throughout are of solid construction with a floated timber finish. At the time of inspection, the property was vacant but all fit were covered.  Internal joinery and kitchen fittings  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected withou removing fittings. No tests whatsoever were carried out to it system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are fruited off, the		Ceilings are of reinforced concrete with an artex finish.
Using a moisture meter, walls were randomly tested for dampness where considered appropriate.  Internal walls are party of concrete and partly dry lined.  Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.  Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subjet to a minimum clearance of 1m between the underside of floot joists and the solum as determined from the access hatch.  Floors throughout are of solid construction with a floated timber finish. At the time of inspection, the property was vacant but all fit were covered.  Internal joinery and kitchen fittings  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected withou removing fittings. No tests whatsoever were carried out to it system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are fruited off, the	Internal walls	Visually inspected from floor level
Internal walls are party of concrete and partly dry lined.    Floors including sub floors	internal wans	visually hispected from floor level.
Floors including sub floors  Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.  Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subjet to a minimum clearance of fm between the underside of floo joists and the solum as determined from the access hatch.  Floors throughout are of solid construction with a floated timber finish. At the time of inspection the property was vacant but all flowere covered.  Internal joinery and kitchen fittings  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		
carpets or floor coverings were lifted.  Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subjet to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.  Floors throughout are of solid construction with a floated timber finish. At the time of inspection the property was vacant but all flowere covered.  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		Internal walls are party of concrete and partly dry lined.
Surveyor deems it is safe and reasonable to do so, and subjet to a minimum clearance of 1m between the underside of floo joists and the solum as determined from the access hatch.  Floors throughout are of solid construction with a floated timber finish. At the time of inspection the property was vacant but all flowere covered.  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	Floors including sub floors	
Internal joinery and kitchen fittings  Built-in cupboards were looked into but no stored items were moved.  Kitchen units were visually inspected excluding appliances. The kitchen is of a reasonable size for a property of this type and fitted with ample storage units. The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected. The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor
moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		finish. At the time of inspection the property was vacant but all floor
moved.  Kitchen units were visually inspected excluding appliances.  The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were
The kitchen is of a reasonable size for a property of this type and fitted with ample storage units.  The internal doors are of timber construction.  Chimney breasts and fireplaces  There are no open fireplaces within the property.  Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	internal joinery and kitchen hangs	
fitted with ample storage units. The internal doors are of timber construction.  Chimney breasts and fireplaces There are no open fireplaces within the property.  Internal decorations Visually inspected. The walls and ceilings are papered and painted.  Cellars None.  Electricity Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		Kitchen units were visually inspected excluding appliances.
Chimney breasts and fireplaces  There are no open fireplaces within the property.  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		The kitchen is of a reasonable size for a property of this type and is fitted with ample storage units.
Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		The internal doors are of timber construction.
Internal decorations  Visually inspected.  The walls and ceilings are papered and painted.  Cellars  None.  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	Chimney breasts and firenlaces	There are no open firenlaces within the property
The walls and ceilings are papered and painted.  Cellars  None.  Accessible parts of the wiring were visually inspected withour removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	Chilling breasts and incplaces	There are no open ineplaces within the property.
Cellars  None.  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	Internal decorations	Visually inspected.
Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		The walls and ceilings are papered and painted.
Electricity  Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the		
removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess an services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the	Cellars	None.
	Electricity	surveyor will state that in the report and will not turn them on.  There is a mains supply of electricity to the property and the electric

Gas	There is no gas supply to the building.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	There is a mains supply of water to the property and the main stopcock is located within the kitchen. The plumbing installation where visible is in copper and PVC piping.
	The sanitary arrangements comprise a shower room with WC.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	There is electric off peak heating installed with heaters throughout.
	Hot water is provided from an immersion heater.
Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is connected to the main sewer.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	Smoke detectors are installed bit were not tested.
Any additional limits to inspection	For flats / maisonettes
	Only the subject flat and internal communal areas giving access to the flat were inspected.
	If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.
	The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.
	At the time of inspection the property was vacant but all floors covered.
	The external inspection was carried out from ground level within the

boundaries of the property and from adjoining highways. The inspection was limited to the subject flat and accessible common areas only.


Areas of the property that were covered, unexposed or inaccessible have not been inspected. It cannot be confirmed that such areas are free from infestation, decay or other defects.

It should be appreciated that further defects can arise after the date of inspection.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

#### Sectional Diagram showing elements of a typical house

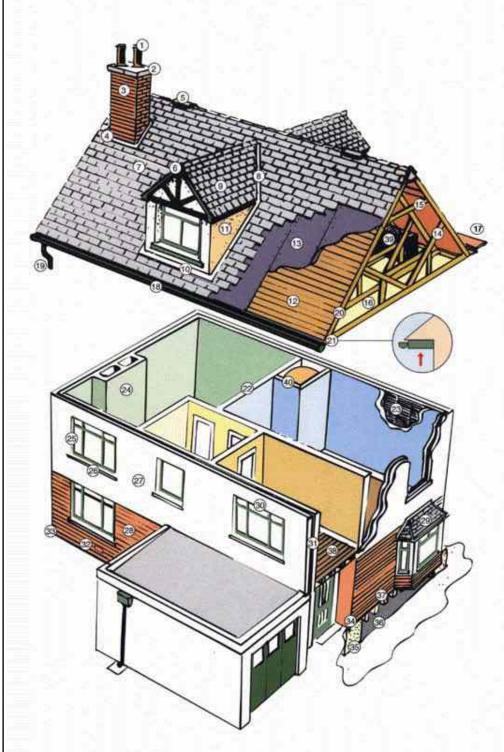

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- (2) Coping stone
- 3) Chimney head
- 4) Flashing
- (5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9 Dormer projection
- (10) Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- 13) Roof felt
- (14) Trusses
- (15) Collar
- (16) Insulation
- 7) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- O Verge boards /skews
- (21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- (25) Window pointing
- S .....
- 26) Window sills
- (27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- Floor joists
- 8 Floorboards
- 39) Water tank
- 10) Hot water tank

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	The property appears to be in sound structural order with no sign of any significant movement to the main building.  The property was subject to a structural report at the time of refurbishment in 1987.

Dampness, rot and infestation	
Repair category	1
Notes	Random damp readings were taken throughout the property, no significant levels of dampness were detected. No infestation or decay was apparent to the exposed timbers.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	From the ground level the roof structure appeared to be of a satisfactory condition.

Rainwater fittings	
Repair category	1
Notes	The rainwater pipes appear to be in satisfactory condition. It was not raining sufficiently at the time of inspection to indicate leakage.

Main walls	
Repair category	3
Notes	The surface condition was satisfactory.  It is good practice to periodically check the condition of any EWI system on any building of any height and all building owners should consider the need to undertake such checks as part of their regular maintenance and management plan.

Windows, external doors and joinery	
Repair category	1
Notes	Where tested the window and doors function satisfactorily.

External decorations	
Repair category	1
Notes	The external decoration is to a reasonable standard.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	1
Notes	Front forecourt is in satisfactory condition. The communal grounds are maintained by the Local Authority.

Ceilings	
Repair category	1
Notes	The ceilings are finished with artex. The surface condition is satisfactory.

Internal walls	
Repair category	1
Notes	The wall surfaces are generally satisfactory.

Floors including sub-floors	
Repair category	1
Notes	Where accessible the floor surfaces were satisfactory.

Internal joinery and kitchen fittings	
Repair category	1
Notes	The kitchen fittings are in satisfactory condition subject to normal wear and tear.  Doors, skirtings etc are also in reasonable condition.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	1
Notes	The internal decoration is to a reasonable standard allowing for personal taste.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.

Gas	
Repair category	-
Notes	Not applicable.

T- Water, plumbing and bathroom fittings	
Repair category	1
Notes	There is evidence of condensation to the shower room fittings.  It is important to maintain a watertight seal around various fittings and appliances to prevent water spillage as in damage to surrounding surfaces and concealed areas. It is not possible to comment on the condition of concealed areas.

Heating and hot water		
Repair category	1	
Notes	The electric heating system has not been tested.	

Drainage	
Repair category	1
Notes	Above ground drainage appears satisfactory.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	3
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	2
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

#### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

The tenure is understood to be outright ownership.

The property form part of a tenement/block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

The property is of non traditional construction. It should be appreciated that a variety of lending institutions will not advance funds on property of this type. This has the effect over restricting the saleability. We have however endeavoured to reflect all relevant factors at arriving at our undernoted valuation. A suitable source of lending should be confirmed prior to a commitment to purchase.

The subject property is contained within a block which was completely refurbished around 1987. It is understood that prior to refurbishment a structural inspection of the block was carried out by Ove Arup and the refurbishment was undertaken following recommendations laid down by the engineer and firm. The valuation assumes that all necessary Local Authority Consents in respect of these works have been obtained.

Ideally building owners should obtain design records, construction details, specifications and system certification for the External Wall Insulation system (EWI), and appoint suitable professional advisers to assess the adequacy of the design and installation.

#### Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes it is recommended that the subjects be insured for a sum of not less than £83,000 (Eighty-Three Thousand Pounds Sterling).

#### Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 05 August 2020 is £30,000 (THIRTY THOUSAND POUNDS STERLING).

Signed	Security Print Code [519739 = 6823 ] Electronically signed	
Report author	ROBERT T FRASER	
Company name	DM HALL LLP	

Address	Shed 26 Unit 34, City Quay, Camperdown St, Dundee, Dundee & Angus, DD1 3JA
Date of report	13th August 2020

# PROPERTY QUESTIONNAIRE





Property address	42 SPECKLED WOOD COURT, DUNDEE, DD4 0LY
Seller(s)	MRS ALISON HOWITT
Completion date of property questionnaire	05/08/20

#### **Note for sellers**

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

#### Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? 6 months
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	A B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	Allocated parking space
	Driveway
	Shared parking
	On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?  Yes / No / Don't know

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes</del> / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered yes, please describe below the changes which you have made:	<del>Yes</del> / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	<del>Yes</del> / <del>Ne</del>
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	<del>Yes</del> / No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / <del>No</del>
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):  Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<del>Yes</del> / No / <del>Partial</del>
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	
C.	Do you have a maintenance contract for the central heating system?	<del>Yes</del> / Ne
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<del>Yes</del> / No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<del>Yes</del> / No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<del>Yes</del> / <del>Ne</del>
b.	Are you aware of the existence of asbestos in your property?	<del>Yos</del> / No
	If you have answered yes, please give details:	

	Please tick which services are connected to your property and give details of the supplier:						
	Services	Connected	Supplier				
	Gas / liquid petroleum gas						
	Water mains / private water supply	✓	Scottish water I think				
	Electricity	✓	SSE				
	Mains drainage	✓	Don't Inow				
	Telephone  Cable TV / satellite	✓	Virgin Media				
		✓	Don't know				
	Broadband						
).	Is there a septic tank system at yo  If you have answered yes, please a		questions below:	<del>Yes</del> / No			
; <u>.</u>	(i) Do you have appropriate conse	nts for the discl	narge from your septic tank?	Yes / No / Den't know			
l.	(ii) Do you have a maintenance co  If you have answered yes, please have a maintenance contract:			¥es / No			

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	<del>Yes</del> / <del>No</del> / Don't Know
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	Yes / <del>No</del> / <del>Not applicable</del>
	If you have answered yes, please give details:	
	J Reavley factoring deal with this	
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<del>Yes</del> / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	<del>Yes</del> / No
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	<del>Yes</del> / No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	<del>Yes</del> / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yes / <del>No</del>
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	
	J Reavley 17-21 Taits Lane Dundee DD2 1DZ £37 per month	

b.	Is there a common buildings insurance policy?	<del>Yes</del> / <del>Ne</del> / Don't Know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<del>Yes</del> / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<del>Yes</del> / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	No	¥es	Don't know	With title doods	Lost	Cannot Answor*
(iii)	Central heating	No	Yes	Don't know	With title doods	Lost	Cannot Answor*
(iv)	NHBC	No	Yos	Don't know	With title doods	Lost	Cannot Answor*
(v)	Damp course	No	¥es	Don't know	With title doods	Lost	Cannot Answor*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	se give de	etails of t	he work		
c.	Are there any outstanding claims under any of the guarantees listed above?  If you have answered yes, please give details:					Yes / No	
15.	Boundaries						
	So far as you are aware, has any boundary of your property been moved in the last 10 years?  If you have answered yes, please give details:					<del>Yes</del> / <del>No</del> / Don't know	

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	<del>Yes</del> / <del>Ne</del> / Don't know
b.	that affects your property in some other way?	<del>Yes</del> / <del>No</del> / Don't know
C.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yos</del> / <del>No</del> / Don't know
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
-			
Date:			

# **DM Hall Offices**

Aberdeen 01224 594172

Ayr 01292 286974

Cumbernauld 01236 618900

Cupar 01334 844826

Dumfries 01387 254318

Dundee 01382 873100

**Dunfermline** 01383 621262

Edinburgh 0131 477 6000

Elgin 01343 548501

Falkirk 01324 628321 Galashiels Livingston 01896 752009 01506 490404

Glasgow (North) Mus 0141 332 8615 013

Glasgow (South) 0141 636 4141

Hamilton 01698 284939

Inverness 01463 241077

Inverurie 01467 624393

01294 311070

Irvine

Kirkcaldy 01592 598200

Musselburgh

0131 665 6782

Oban

01631 564225

Paisley

0141 887 7700

Perth

01738 562100

Peterhead 01779 470220

Stirling 01786 475785

DMHALL.CO.UK